



**Flight Evaluation of the Communications  
Earplug in the OH-58D Helicopter**

**Part 2. Questionnaire Data**

**By**

**Barbara A. Murphy  
and  
Ben T. Mozo**

**Aircrew Protection Division**

**October 1999**

Approved for public release, distribution unlimited.

**U.S. Army Aeromedical Research Laboratory  
Fort Rucker, Alabama 36362-0577**

## Notice

### Qualified requesters

Qualified requesters may obtain copies from the Defense Technical Information Center (DTIC), Cameron Station, Alexandria, Virginia 22314. Orders will be expedited if placed through the librarian or other person designated to request documents from DTIC.

### Change of address

Organizations receiving reports from the U.S. Army Aeromedical Research Laboratory on automatic mailing lists should confirm correct address when corresponding about laboratory reports.

### Disposition

Destroy this document when it is no longer needed. Do not return it to the originator.

### Disclaimer

The views, opinions, and/or findings contained in this report are those of the author(s) and should not be construed as an official Department of the Army position, policy, or decision, unless so designated by other official documentation. Citation of trade names in this report does not constitute an official Department of the Army endorsement or approval of the use of such commercial items.

### Human use

Human subjects participated in these studies after giving their free and informed voluntary consent. Investigators adhered to AR 70-25 and USAMRMC Reg 70-25 on Use of Volunteers in Research.

# REPORT DOCUMENTATION PAGE

Form Approved  
OMB No. 0704-0188

1a. REPORT SECURITY CLASSIFICATION Unclassified		1b. RESTRICTIVE MARKINGS			
2a. SECURITY CLASSIFICATION AUTHORITY		3. DISTRIBUTION / AVAILABILITY OF REPORT Approved for public release, distribution unlimited			
2b. DECLASSIFICATION / DOWNGRADING SCHEDULE					
4. PERFORMING ORGANIZATION REPORT NUMBER(S) USAARL Report No. 2000-05		5. MONITORING ORGANIZATION REPORT NUMBER(S)			
6a. NAME OF PERFORMING ORGANIZATION U.S. Army Aeromedical Research Laboratory	6b. OFFICE SYMBOL <i>(If applicable)</i> MCMR-UAD	7a. NAME OF MONITORING ORGANIZATION U.S. Army Medical Research and Materiel Command (USAMRMC)			
6c. ADDRESS (City, State, and ZIP Code) P.O. Box 620577 Fort Rucker, AL 36362-0577		7b. ADDRESS (City, State, and ZIP Code) 504 Scott Street, Fort Detrick, MD 21702-5012			
8a. NAME OF FUNDING / SPONSORING ORGANIZATION US Army Medical Rsch Acq Act	8b. OFFICE SYMBOL <i>(If applicable)</i> MCMR-AAA-A	9. PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER			
8c. ADDRESS (City, State, and ZIP Code) 829 Chandler Street Fort Detrick, MD 21702-5009		10. SOURCE OF FUNDING NUMBERS			
		PROGRAM ELEMENT NO. 63787A	PROJECT NO. 3016287A878	TASK NO. OF	WORK UNIT ACCESSION NO. DA360347
11. TITLE (Include Security Classification) Flight Evaluation of the Communications Earplug in the OH-58D Helicopter, Part 2: Questionnaire Data (U)					
12. PERSONAL AUTHOR(S) Barbara A. Murphy and Ben T. Mozo					
13a. TYPE OF REPORT Final	13b. TIME COVERED FROM TO	14. DATE OF REPORT (Year, Month, Day) 1999 October	15. PAGE COUNT 97		
16. SUPPLEMENTAL NOTATION					
17. COSATI CODES			18. SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD	GROUP	SUB-GROUP			
19. ABSTRACT (Continue on reverse if necessary and identify by block number) Aviators assigned to OH-58D helicopter operational units participated in an expanded field assessment of the communications earplug (CEP). The CEP is a low cost and simple approach that is readily available for immediate fielding. During FY97, Project Manager-Aircrew Integrated Systems (PM-ACIS) purchased enough CEPs to outfit all aviators currently assigned to OH-58D operational units. The objective of the study was to form a large sample of users for evaluating the effectiveness of the current CEP configuration in solving hearing protection and communication problems in the OH-58D helicopter. The CEP performs well during daily missions and is considered a viable solution to the problem of inadequate speech clarity and understanding in the Kiowa Warrior helicopter. Part 1 of this report, published separately, presents the method and assessment findings of the study. Part 2, the present report, contains the dataset to allow close inspection of individual subject responses.					
20. DISTRIBUTION / AVAILABILITY OF ABSTRACT <input checked="" type="checkbox"/> UNCLASSIFIED/UNLIMITED <input type="checkbox"/> SAME AS RPT. <input type="checkbox"/> DTIC USERS			21. ABSTRACT SECURITY CLASSIFICATION Unclassified		
22a. NAME OF RESPONSIBLE INDIVIDUAL Chief, Science Support Center			22b. TELEPHONE (Include Area Code) (334) 255-6907	22c. OFFICE SYMBOL MCMR-UAX-SS	

## Preface

This work was funded by the Project Manager-Aircrew Integrated Systems (PM-ACIS). The authors would like to thank all the individuals involved in the installation of the Communications Earplug into the HGU-56/P helmets.



Table of contents

	<u>Page</u>
Background to questionnaire dataset.....	1
Questionnaire responses.....	2
Questions 1 thru 8 .....	2
Questions 9 thru 13 .....	9
Questions 14 thru 17 .....	17
Questions 18 thru 24 .....	28
Questions 25 thru 29 .....	39
Questions 30 thru 33 .....	47
Questions 34 thru 41 .....	59
Questions 42 thru 43 .....	66
Questions 44 thru 45 .....	74
Reference.....	92
Appendix .....	93

List of figures

Figure 1. CEP integrated into HGU-56/P aviator helmet.....	1
--	---

### Background to the questionnaire data set

During FY 97, the Project Manager, Aircrew Integrated Systems (PM-ACIS) purchased enough Communications Earplugs (CEPs) to outfit all aviators currently assigned to OH-58D operational units. The CEPs were installed in HGU-56/P aviator helmets under the direction of PM-ACIS, with assistance provided by the U.S. Army Aeromedical Research Laboratory (USAARL). The acceptability of the CEP was assessed by asking aviators to compare the CEP helmet combination (Figure 1) with the helmet systems currently used in the OH-58D helicopter.

A novel questionnaire was constructed for this study (Appendix). The questionnaire consists of eight general sections: personal data, personal hearing protection, fitting, comfort, donning and doffing, speech clarity/understanding, noise reduction/attenuation, and general issues.

Part 1 of this report contains the details of the methods, analysis, and results of this survey research (Murphy and Mozo, 1999). This publication, Part 2, contains the data tables necessary to allow close inspection of individual subject responses

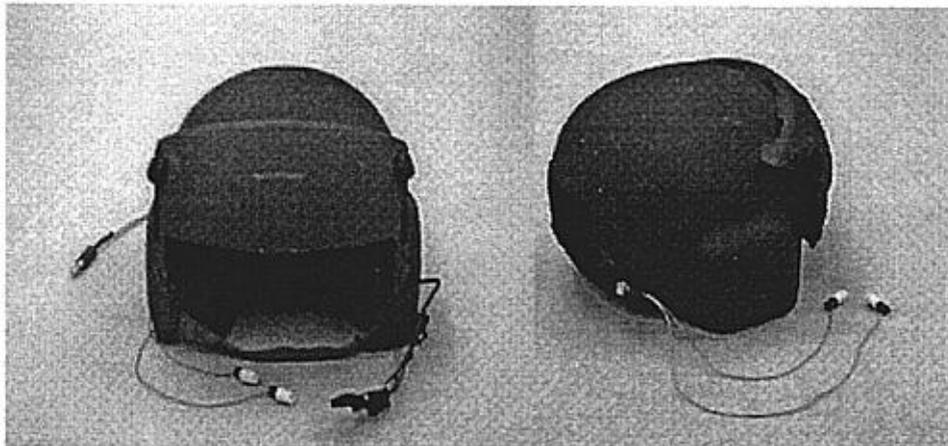


Figure 1. CEP integrated into HGU-56/P aviator helmet.

# CEP Flight Evaluation in the OH-58D Helicopter

Q1 Unit location	Q1 ID Num	Q3 Gender	Q4 <u>Aviator Experience</u> Years Flight Hours		Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Q6a <sup>1</sup> CEP still functioning	Q7 Tip size	Q8 Seat position
1.	1	M	7	1000	300		1	short	Right
	2	M	3	420	120		1	std	Right
	3	M	10	2200	600		0 Plastic post attached to left ear piece snapped off	std	Right
	4	M	6	1700	300	50	1	std	Right
	5	M	3	600	50	100	1	short	Both
	6	M	3	600	400	200	1	std	
	7	M	4	1000	300		1	short	Left and right
	8	M	7	500	65	60	1	std	Left
	9	M	2	500		250	1	std	Left
	10	M			100	8	0 Screw-tip portion broke off on right ear plug	std	Right
	11	M	4	500	350	150	1	std	
	12	M	8	1500	300	200	1	Combo	Left and right
	13	M	2	440	240	200	1	std	Left and right
	14	M	3	550	225	125	1	std	Right and left equal
	15	M	4	600	150		1	short	Right
	16	M	11	1500	150	125	1	short	Left
	17	M	7	1500	50	25	0 Because it broke at ear cushion connection	slim	Both
	18	M	3	640	200	250	0 Right earplug broke off from cable	std	Fixed
	19	M	2	365	120	100	1	std	Both
	20	M	4	700	695	5	0 One of the troops crew chiefs thought they were just earplugs then just lost them	std	Right/pilot

<sup>1</sup> For the Yes/No questions, "Yes"=1 and "No"=0

Q1 Unit location	Q1 ID Num	Q3 Gender	Q4 Aviator Experience		Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Q6a CEP still functioning	Q7 Tip size	Q8 Seat position
			Years	Flight Hours					
1.	21	M	2	500	50	110	1	std	Left and right Right
	22	M	5	900	100		1	std	
	23	M	3	350	100	20	1	std	Both
2.	1	M	2	430		200	0 Left earplug separated at earplug housing from wire during NBC flight.	std	
	2	M	4	750	300		1	std	Right
	3	M	4	530	400	150	1	std	Right
	4	M	3	500	120		1	std	Standard
	5	M	5	900	400		1	std	Split duties right and left.
	6	F	5	900	300	250	1	short	R/L
	7	M	6	1000	200	200	1	std	Right
	8	M	4		400	100	1	std	Left or right
	9	M	3	500	100		1	std	Right
	10	M	4	850	100	300	1	std	Both
	11	M	7	850	120	80	1	std	Left
	12	M	6	1200		300	0 My original pair broke. I'm on my third pair.	std	Left
	13	M	10	2000	300	300	0 Wire broke	std	Left
	14	M	2	500		250	1	std	Left
	15	M	5	750	70	100	0 Ear portion and cord became separated when caught up in the survival vest during	std	Both
16	M	4	650	400	50	0 Screw tip broke off	std	Right	
17	M	5	750	25		0 Left wire into speaker is loose and sound comes in and out	std	Right	
18	M	2	400	225		0 Intermittent operation on right side	std	Right	

Q1 Unit location	Q1 ID Num	Q3 Gender	Q4 <u>Aviator Experience</u> Years Flight Hours	Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Q6a CEP still functioning	Q7 Tip size	Q8 Seat position
2.	19	M	3 550	75		0 Wires broke away from ear piece	std	
	20	M	5 700	230	180	1	Combo	Right/left equal
3.	1	F	2 400	150	1	1	std	Left
	2	M	6 2300	150	100	1 After one repair of broken stem	std	R/L
	3	M	10 1600	400	300	1	std	Right
	4	M	4 500	150		1	slim	Left
	5	M	5 800	601		1	std	Right
	6	M	6 1200	200	200	1	slim	Right
	7	M	5 900	100	200	1	short	Right
	8	M	4 1200	70		0 The foam earplugs broke off after first use. ALSE repaired and it took about 5 more flight hours before they broke again	std	Right/left
	9	M	10 1500	200	200	1	std	Right
	10	M	2 500	50	250	1	std	Right/Left
	11	M	2 500	100	200	1	std	Right
	12	M	6 1250	250	15	1	std	N/A
	13	M	13 3300	400		0 Wire broke on one side where wire connects to plug itself.	std	Right
	14	M	2 650	200		1	std	Both left and right0
	15	M	10	30	6	1	std	Upright
	16	M	10 2100	70	5	1	std	Right
	17	M	3 450	0	0	0 Bong and whistles are too damned loud	std	Right
4.	1	M	4 800			1	std	Right
	2	M	2 430	150	50	1	std	Upright

Q1 Unit location	Q1 ID Num	Q3 Gender	Q4 <u>Aviator Experience</u> Years Flight Hours		Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Q6a CEP still functioning	Q7 Tip size	Q8 Seat position
4.	3	M	4	1200	40		1	std	
	4	M	5	1100	200		1	slim	Right
	5	M	4	550	50		1	short	Left seat
	6	M	4	670	100		1	slim	Both
	7	M	9	1600		70	1		Right seat
	8	M	5	1000	60	40	1	std	Yes
	9	M	2	300	50		1	std	Left
5.	1	M	1	499	9		1	short	Left
	2	M	5	1000		200	1	std	Right
	3	M	9	2300	250		1	std	Left
	4		1	250	240	10	1	std	Left
	5	M	2	400	20	10	1		Equally left and right
	6	M	5	670	15		1	std	
	7	M	5	800	100		1	std	Left
	8	M	3	400	10	100	1	std	Left/right
	9	M	17	5000		30	1	std	Both
	10	M	2	400	20	20	1	std	Left and right equally
	11	M	3	400	6		1	short	Right
	12		9	2500	40	125	0	slim	Left
									Left earplug intermittent, possibly due to wire breaking. ALSE issued me a new CEP.
	13	M	4	590	40	6	1	std	Equal both seats.
	14	M	2	400	120	2	1		Right
	15	M	3	500	50	10	1	std	Right
	16	M	15	2500		10	1	std	

Q1 Unit location	Q1 ID Num	Q3 Gender	Q4 <u>Aviator Experience</u> Years Flight Hours	Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Q6a CEP still functioning	Q7 Tip size	Q8 Seat position
6.	1	M	6 1100	200	300	1 None	std	N/A
	2	M	9 2200	400	200	1 None	short	Right
	3	M	2 200	50		1	std	Left
	4	M	8 725	275	125	1	slim	Left
	5	M	6 750			0 Earplug broke off at tip.	short	Left and right
	6	M	13 3100	150	150	1	std	Left
	7	M	5 1000	100		1	std	Both
	8	M	6 1400		100	1	std	Left and right
	9	M	6 1200	500		1	std	Left and right
	10	M	10 2100	600	4	1		Right
7.	1	F	4 500	100	50	1	slim	Left/right
	2	M	5 1115			1	std	Left
	3	M	3 400	5	110	1	short	Right
	4	M	2 470	100		1	short	Both equally
	5	M	15 4000	500	200	1	slim	OH-58D(I) has one seat position
	6	M	6 1000	800	200	1	slim	Left and right
	7	M	10 1700	200		1	std	Either
	8	M	4 550	150		1	std	Both
	9	M	6 1400	200	150	0 Wires broke	slim	Left
	10	M	7 1350	20		1	std	Left
	11	M	4 900	100	200	0 Broken wire, broken earplug tip	std	Left/right
	12	M	2 400	200		0 Broken wire and earplug tip.	std	Left/right
	13	M	8 2700	300	250	1	std	Either of the two front seats
	14	M	8 1200	150		1	std	OH-58D(I) the only position

Q1 Unit location	Q1 ID Num	Q3 Gender	Q4 <u>Aviator Experience</u> Years Flight Hours		Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Q6a CEP still functioning	Q7 Tip size	Q8 Seat position
7.	15	M	2	600	500		0 Wire keeps breaking from the foam earplug.	std	right
	16	M	6	900	200	150	1	short	Both
	17	M	6	1200			1	std	Both
	18	M	4	550	400		1	std	
	19	M	8	850	150	200	1	std	Left
	20	M	8	1400	1	200	1	std	Left/right
	21	M	15	3200	50	100	1	std	Equal
	22	M	6	1200	200	150		std	Right
	23	M	6	900	12		1	std	Left
8.	1	M	30	10500		250	1	slim	Left and right
	2	M	8	2400		400	1	std	Left
	3	M	10	2200		200	1	short	Equally left and right
	4	M	14	4500	300	50	1		Pilot or copilot
	5	M	10	2700	6		1	std	Left
	6	M	18						
	7		9	2700	2300			std	Seat does not move
	8	M	16	4000		250	1	short	Both pilot and copilot
	9	M	16	4500		50	1	std	Left seat
	10	M	7	1800		20	1		Equal
	11	M	8	2500		200	1	std	Left
	12	M	15	4500		200	1	std	Left and right
	13	M	6	1000			1 Twice broken/ shorted wire	slim	Both
	14	M	17	5000		50	1	short	Right and left
	15	M	16	5400		20	1	std	Left

Q1 Unit location	Q1 ID Num	Q3 Gender	Q4 <u>Aviator Experience</u> Years Flight Hours		Q5 Flight hours using HGU-56	Q6 Flight hours using CEP	Q6a CEP still functioning	Q7 Tip size	Q8 Seat position
8.	16	M	5	1600	1300	300	1	slim	Left
	17	M	6	1700	250	20	1	std	Left and right
9.	1	M	3	500	50		1	slim	L/R
	2	M	7	1200	100	150	1	std	Right seat
	3	M	19	3400	25	200	0	std	Dead right plug Left
	4	M	3	500	200	300	1	slim	Both
	5	M	4	600	250	150	1	std	Right
	6	M	3	570		70	1	std	Both
	7	M	15	4100	2	400	1	std	Both
	8	M	6	1000	100	50	1	short	Left
	9	M	3	350	10	4	1	std	Left
	10	M	12	3000	100	50	1	std	Both
	11	M	11	1800		10	1	std	Right
	12	M	15	1300	15	10	1	std	Fixed
	13	M	5	500	150	50	1	short	Even split L/R
	14	M	4	800	50	150	1	short	Right
	15	M	4	600	10	10	1	slim	Left
	16	M	3	500			1	short	
10.	1	M	5	750		150	1	std	Right and left
<b>Overall Total</b>		<b>M = 146</b> <b>F = 3</b> <b>NR = 3</b> <b>N = 152</b>	<b>Sum 963.5</b> <b>Avg 6.4</b>	<b>199414.0</b> <b>1347.4</b>	<b>Avg 205.3</b>	<b>Avg 129.4</b>	<b>Yes = 126</b> <b>N = 23</b> <b>NR = 3</b>		

Q1 Unit location	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description
1.	1	0	0		1	1	Lack of ICS volume 0
	2	0	0		1	1 2-3 hours, combined w/ hearing difficulty	Pain 1 3-4 hours Hot spots, headaches
	3	0	0		1	0	0
	4	0	0		1	0	0
	5	0	0		1	0	0
	6	0	0		0		0
	7	0	0		1	0	0
	8	0	1	Bayonet	1	0	0
	9	0	0		1	0	0
	10	0	0		1	0	0
	11	0	0		1	1 Only until I break them in	Slight pain 0
	12	0	0		1	0	0
	13	0	0		1	0	0
	14	0	0		1	0	0
	15	0	0		0	1	Pain in the ear canal 0
	16	0	0		0		0
	17	0	0		0	1 Few hours	dull pain, continuous after a few days flying 0
	18	0	0		1	0	1 30 minutes Sometimes just slight discomfort from the size of the speaker; other times it felt as though the plastic portion of the plug was contacting my ear canal.
	19	0	0		1	0	0
	20	0	0		1	1 2 hours	Itching, sweating 0

Q1 Unit location	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description
1.	21	0	0		1	0	0
	22	0	0		1	0	0
	23	0	0		1	0	0
2.	1	0	1	Wire frames	1	0	0
	2	0	0		1	1 Itchiness	0
	3	0	0		1	0	0
	4	0	0		0		0
	5	0	0		0	0	0
	6	0	0		1	1 3-4 hours Itchiness, pain	0
	7	0	0	Sunglasses during the day	1	0	0
	8	0	1	Cable	1	0	0
	9	0	0		1	0	0
	10	0	0		1	0	1 2.5-3.0 hrs Hot spot under NVG only
	11	0	0		1	0	1 1 hour Hot spots
	12	0	0		1	0	0
	13	0	0		0		0
	14	0	0		1	0	0
	15	0	0		1	1 2-3 hours Aching in inner ear	1 2-3 hours Hot spot on top of head. Bottom of earcups chafe neck
	16	0	0		1	0	0
	17	0	0		1	0	1 45 minutes Hot spots
	18	0	0		1	0	0

Q1 Unit location	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description
2.	19	0	0		1	0	1 Beginning to end Pain inside ear opening
	20	0	0		1	0	1 1-2 hours Hot spot top of my head with NVGs, 3-4 hours w/o NVGs
3.	1	0	0		1	1 30 minutes	1 30 minutes hotspots
	2	0	1	Bayonet	1	0	0
	3	0	0		1	0	0
	4	0	0		1	1	0
	5	0	0			0	0
	6	0	0		1	0	0
	7	0	0		1	0	1 2 hours hotspots usually associated with NVGs
	8	0	0		1	0	0
	9	0	0		1	0	0
	10	0	0		1	0	0
	11	0	0		1	0	1 2 hours hotspot
	12	0	0		0		0
	13	0	0		1	0	0
	14	0	0		1	0	0
	15	0	0		1	0	0
	16	0	1		1	0	0
	17	0	0		1	0	0
4.	1	0	0		1	1 15-20 minutes if not immediately. The plastic core presses into the ear when the cup is placed over it.	0

Q1 Unit location	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description		
4.	2	0	0		1	1 Varies	Itchiness, uncomfortable, slipping	0	
	3	0	0					0	
	4	0	0		1	0		0	
	5	0	1	Bayonet temples, wire frames.	1	1 About 3 hours	Pain in upper ear.	0	
	6	0	0		1	1 Varies from 15 minutes to 1 hour.	Itchiness with a lot of discomfort.	1 15 minutes	Hot spot on forehead.
	7	1	1 year		0			0	
	8	0	0		1	1	Itchiness, pain	1 1 hour	Hot spots, headache
	9	0	0		1	0		1 Soon	Hot spots
5.	1	0	0		1	0		0	
	2	0	0		1	0		0	
	3	0	0		0	0		1	Headaches (noise
	4	0	0		1	0		0	
	5	0	0		1	0		1 30 minutes	Hot spot on top of helmet.
	6	0	0		1	0			
	7	0	0		1	1 As soon as I put them in.	Pain - the foam earplugs when screwed in - the screwed in part stabs my ear so I can't place the foam part as far in as I like too.	0	
	8	0	0		0	0		1 1 hour	Hot spots on forehead, headaches.
	9	1	0		1	1 After a couple of adjustments I could fix the discomfort.	Pain		

Q1 Unit location	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description
5.	10	0	0		1	0	
	11	0	0		1	0	
	12	0	0		1	1	Itchiness 0
	13	0	0		1		1 3 hours Hot spots
	14	0	0		0		0
	15	0	0		1	0	0
	16	0	0		1	0	0
6.	1	0	0		0		0
	2	0	1	Strap	0		0
	3	0	0		1	1	Dull pain. Some itchininess. 1 2 hours Head itches.
	4	0	0		1	0	0
	5	0	1		1	0	0
	6	0	0		1	0	0
	7	0	0		1	0	0
	8	0	0		1	0	0
	9	0	0		1	0	0
	10	0	0		1	0	0
7.	1	0	0		0	0	0
	2	0	0		1	0	0
	3	0	0		1	0	0
	4	0	0		1	0	1 30 minutes hot spots
	5	0	1	Comfort cables (wrap around)	0		0
	6	0	0		1	0	0

Q1 Unit location	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description				
7.	7	1	In process	1	Bayonet	1	0	1	After 1.5 hours	Hot spot	
	8	0		0		0	0	0			
	9	0		0		1	0	0			
	10	0		0		0	0	0			
	11	0		0		0		0			
	12	0		0		1	0	0			
	13	0		0		1	0	0			
	14	0		1	Wire	1	0	0			
	15	0		0		0		0			
	16	0		0		1	0	0			
	17	0		0		0	1	2 hours	Itching	1	1 hour
	18	0		1		0					
	19	0		0		1	0	0			
	20	0		1	Wire frame Ray-Ban sunglasses	1	0	0			
	21	0		0		1	0	0			
	22	0		0		1	0	0	1/2 hour	Hot spots and headache. Just don't like that style helmet. Too big and bulky.	
	23	0		0		1	0	0	1	1 minute	Could not hear!
8.	1	1	16 years	1	Bayonet temples	1	0	0			
	2	0		0		1	0	0			
	3	0		0		1	0	0			
	4	0		0		1	1	Within 45 minutes	Poking pain	0	

Q1 Unit location	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description
8.	5	0	0		1	1 About 30 minutes	Ear pain 0
	6	0	0		1	0	0
	7	0	0		0	0	0 I did after I tried to use it.
	8	0	0		1	0	0
	9	0	0		1	0	1 1 hour Hot spot top center of forehead.
	10	0	0		1	0	0
	11	1	2 years		0	0	0
	12	0			1	0	0
	13	0			1	2-3 hours	pain 0
	14	0			1	0	0
	15	0			0	1 5-10 minutes	Pain in ear canal. Full feeling in my head. 0
	16	0	0		1	0	0
	17	0	1	Wire frames	1	0	0
9.	1	0	0		1	0	0
	2	0	0		1	0	0
	3	1	8 years		1	0	0
	4	0		Wrap around	1	0	0
	5	0			1	0	0
	6	0			1	0	0
	7	0			1	0	0
	8	0			1	0	1 1 hour Hot spots
	9	0			1	0	0

Q1 Unit location	Q1 ID Num	Q9 Waiver or IO letter	Q10 Fly with spectacle	Spectacle type	Q11 Wear earplugs with helmet	Q12 Discomfort w/earplugs - onset and description	Q13 Discomfort w/ helmet - onset and description
9.	10	0	1	Wire frames	0	0	0
	11	0	0		0		0
	12	1	0		1	1	Itching pain 1 45 minutes Hot spots
	13	0	0		1	0	0
	14	0	0		1	0	0
	15	0	0		1	0	0
	16	0	0		1	0	0
10.	1	0	0		1	0	0
<b>Overall Total</b>	<b>N = 152</b>	<b>Yes = 7</b> <b>N = 145</b> <b>NR = 0</b>	<b>Yes = 17</b> <b>N = 135</b> <b>NR = 0</b>		<b>Yes = 121</b> <b>N = 29</b> <b>NR = 2</b>	<b>Yes = 26</b> <b>N = 110</b> <b>NR = 16</b>	<b>Yes = 27</b> <b>N = 120</b> <b>NR = 5</b>

Q1 Unit location	Q1 ID	Q14 Difficulty in fitting CEP Num	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight
1.					
	1	0	0	0	1 Occasionally slips out of ear
	2	0	0	0	1 Sometimes w/ excessive head movement
	3	0	0	1 Small Velcro piece becomes detached, hangs free and sways.	1 Backs out of ear canal if not fully seated.
	4	0	0	1 They will get caught on anything from shoulder harnesses to flight suit collars	0
	5	1 After washing them they lose their ability to stay crimped during insertion.	0	0	0
	6	1 After repeated use they are difficult to slide in ears - not impossible though.	0	1 Sometimes during NVG flights, the wires get tangled with the NVG neck cord, power cord or battery pack.	1 Occasionally they will fall out of ear during long flight
	7	0	1 The hard post rubs inside of ear.	1 If you make rapid head movements they tend to pull out.	1 After you start to sweat they come out of your ears.
	8	1 Hard to get the CEP into the ear and have it stay in place.	1 There is not as much cushion as with the yellow foam ear plugs.	1 The wires catch on the vest	1 When you sweat the CEP slips out of ear
	9	0	0	1 The wires sometimes become caught on misc. items.	1 They sometimes get pulled down by wire or when I adjust helmet.
	10	0	1 Housing creates a hard object which can press against the outer ear.	1	1
	11	0	0	1 If not attached high enough on the helmet the CEP wire catches on the helmets lower edge	0
	12	1 Earplugs too large initially	1 Plastic screw too long	0	0
	13	0	1	1 About 50% of the time I feel the wire pull when turning my head	1 Occasionally
	14	0	0	0	0
	15	0		1 The wires get caught in the seatbelt or the Velcro strip on the wire gets caught on something	1 from the wire pulling on the earplug during flight

Q1 Unit location	Q1 ID Num	Q14 Difficulty in fitting CEP	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight
1.	16	1	Size adjustment. Needed short	0	0
	17	0		0	1
	18	0		1	tangled around other wires
	19	0		1	They tend to catch under my collar
	20	0		1	They snag on helmet or on flight suit and usually pull out of ear
	21	1	Standard is too fat - slim is too slim	1	Blunt sharp edges on the CEP hurts ear canal
	22	0		1	With the neck cord from the NVGs it sometimes pulls on the CEP cords
	23	0		0	Plastic is hard - after 4-5 days of continuous use, ear canal is sensitive
2.	1	0		0	0
	2	0		0	0
	3	0		0	1
	4	0		0	1
	5	0		0	1
	6	0		0	1
	7	0		0	0
	8	0		0	0
	9	0		0	0
	10	0		0	1

Occasionally, especially when wearing NVGs with the attached lanyard

Occasionally

After about 2 hours, especially on warm days when your start sweating.

tangled around other wires or caught on something

They work themselves loose on long flights

Only if the helmet is moved

Q1 Unit location	Q1 ID	Q14 Difficulty in fitting CEP Num	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight
2.	11	0	0	1 We mount so much stuff on our head, the wires get intermixed	1 Once the foam inserts wear
	12	0	0	1 Sometimes it catches on the other lanyards and wire connections I.e. NVGs, ODA, ICS cable.	0
	13	0	1 Until I get used to the feel of the plug	1	1 Because short wire pulled loose
	14	0	0	1 If I do not remember to keep the cord off my neck and over the survival vest it catches. A fix; create loop or Velcro hold to keep cord on helmet	1 If not inserted fully or hastily and the cord pulls - it comes out
	15	0	1 In the beginning the edges might catch my ear and after a while some mild aching inside the ear	1 Sometimes when caught on something. Mostly not.	1 Only infrequently did one slip out
	16	0	0	1 Sometimes when flying NVGs, while turning head CEP would get pulled out	0
	17	0	0	1 Not often. If it catches on my shirt	1 It has. Installed in a hurry
	18	1 After wearing the CEP for more than 20 minutes the foam tip would not stay compressed for reinsertion back into the ear. Heat and moisture would prevent this	1 Over time the foam tips would begin to itch	1 Wires would frequently catch on objects and pull out of the ear at times	1 At times the foam tip would back out of the ear canal
	19	1 Will not stay in ear	1 Same as above	1 Wires are always in the way	1 At least slips out once on each flight
	20	1 Finding correct size foam insert and the diameter of the CEP itself	0	0	1 Occasionally
3.	1	0	0	1	0
	2	0	0	0	0

Q1 Unit location	Q1 ID Num	Q14 Difficulty in fitting CEP	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning	Q17 CEP move in/out of ear during flight		
3.	3	0	0	1	When Velcro catches on battery pack on helmet or other places such as vest	1	See #16
	4	0	0	1	Well when turning head to left wires are pulled	1	See #16
	5	0	0	1	Some times because of the limited space within the A/C	1	Sometimes when 'live fire" of weapons
	6	0	1	1	The plastic housing hurt my earlobe during the first few weeks. I repositioned by turning and now I can fly 4 hours or so without discomfort	0	Only under NVG flying when I put the CEP in prior to putting on the NVG
	7	0	1	0	Occasionally I fell the hard portion of inner core against eardrum when I insert in earcanal	0	
	8	0	0	1	They get hung up on other things attached to my helmet	1	See 16
	9	0	0	0		0	
	10	0	0	1	Head turns more than 60 degrees left or right it often snags.	0	
	11	0	0	1	Occasionally pull plugs out of ear	1	Occasionally pulled out of place
	12	0	0	1	Loose wire snags on things especially while wearing NVGs	1	
	13	0	0	1	Sometimes while turning head	0	
	14	0	0	1	If the wires are not positioned directly behind my head, the wires get tangled	0	
	15	0	1	1	The plastic center rubs the ear canal and is very uncomfortable	0	Wires too long and catch on ICS cord and other items such as survival vest
	16	0	0	1		0	
	17	1	0	1	When putting helmet on CEP would move and cause discomfort	1	When putting helmet on

Q1 Unit location	Q1 ID	Q14 Difficulty in fitting CEP	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight
4.	1	1 It goes - but intermittently it slides out and I have to continuously readjust the earplug throughout the	1 The plastic core.	1 They slide out during any rapid head movements.	0
	2	0	0	1 Too short	1 Wires too short
	3	1 Difficult to fully put CEP in. Often the wires catch on NVG goggle cord/power supply cord.	1 Pressing earplugs is sometimes painful	1 Sometimes. See #14	1 Cord catches on other wire harnesses, etc.
	4	1 Too big	1 Too big	1	1
	5	0	0	0	1 Once in awhile they slip out when I adjust my helmet.
	6	1 The first set was too big.	1 They poke the sides of my ears.	1 If cable catches on seat belts.	1 Sweat works it out.
	7	0	0	1 Sometimes wire gets in between my collar and neck. The wire sticks to my skin and pulls.	0
	8	0	0	1 Not too bad	1 Not too bad
	9	0	1 Too deep	1 Too short	1 Fall out
5.	1	0	0	1	1 I use the "shorts" which tend to pull out easily
	2	0	1 Until I got used to the plugs, they scraped your ear when putting them in.	0	0
	3	1 Difficult to put helmet on without moving ear plugs.	1 Have to push them in deep in ear so they don't come out when putting helmet on.	1 Sometimes get caught on shoulder straps and vest.	0
	4	0	0	1 Doesn't happen very often. The wires sometimes work themselves between the ALSE vest and the seatbelt/shoulder harness. When you turn your head, it pulls.	0
	5	0	1 It's a little big for my ear canals.	1 They catch on shoulder belts and survival vest behind me.	0

Q1 Unit location	Q1 ID Num	Q14 Difficulty in fitting CEP	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight				
5.	6	0	0	1	The CEP pulls due to wiring laying about the pilots shoulders/neck and coming into contact with other hardware - i.e. wires, seatbelt.	0			
	7	1	Explained in #12	1	Explained in #12	1	Same as #16.		
	8	1	The post is so large that slim/short foam tips cause discomfort resulting in use of the standard.	0		1	Minimal, due to extreme amount of plugs, wires, cables, vests and other misc. equipment jammed into a small cockpit.	0	
	9	1	To long and a little stiff feeling inside the ear.	0		1	Gets caught in my vest behind the helmet.	0	
	10	0		0		1	Only when it gets tangled with the communication plug-in. But if you plug into the aircraft last it doesn't cause a problem.	0	
	11	0		1	After putting the helmet on, the CEP tends to slip and I have to readjust them.	1	They get caught in the harness straps or between my neck and collar.	1	Only once in a while when the wires get caught
	12	0		0		1	At times, not always.	0	
	13	0		0		0		1	Short wire sometimes. Why - unknown. I think it catches on the helmet or shoulder harness or something
	14	0		0		0		0	
	15	0		0		1		0	
	16	1	They seem to be slightly too long, pressure from the ear cup causes slight discomfort to the outer ear.	0		1	Occasionally, not a big deal.	0	
6.	1	0		0		1		0	
	2	0		0		0		0	
	3	0		0		1	With goggles and mic cord, the earplug cords get pulled.	1	Only sometimes.

Q1 Unit location	Q1 ID	Q14 Difficulty in fitting CEP Num	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight
6.	4	0	1 Occasionally the solid plastic portion will scrape ear canal or be inserted too far.	1 Wires get hung up on numerous things (shoulder harness, NVG cable, mic boom, etc)	1 If adjusting helmet, tend to fall out.
	5	0	0	0	0
	6	0	0	1 Once in a while when CEP/NVG power supply/ODA cables get twisted together.	0
	7	0	0	1	1 Only if it gets snagged.
	8	0	1 If pushed in, the inner portion can be felt against inside of ear.	1 Wires get caught on flight vest,	0
	9	0	1 Tip would cause discomfort after 3-4 hours.	0	0
	10	0	1 They are uncomfortable	1 They catch on stuff.	0
7.	1	0	0	1	0
	2	0	1 I found the standard plugs to be too large	1	1 Only during transition wear
	3	1 The earplugs were too long and they were touching my eardrum and causing pain	1 The discomfort is only present when the earplug is not properly in the helmet earcup	1 The wire gets caught on my vest or seatbelt and pulls a little, but it has not been a real problem	0
	4	0	0	1 Solution is to bundle the wire between the NVG weight pack and helmet Velcro, but it is still a pain. The wires get caught on the seatbelt guide and they can be pressed between your back and the seat	1 When the wire is caught on something while turning your head, an earplug can be pulled out of the ear. That's a real pain too
	5	0	1 Initial issue had standard size. Changed to slim.	1 Drag across back of neck (especially when sweaty), sometimes catch on NVG cables or on flight suit collar.	1 From time to time - not always
	6	0	0	1 Wires get caught on survival vest.	1 A few times during flight my CEP has fallen out of my ear.
	7	0	1 The sharp edges on the exterior piece.	1 Ear cushions press against head, can feel pulling of wires when turning head.	0
	8	0	0	1	0

Q1 Unit location	Q1 ID	Q14 Difficulty in fitting CEP Num	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight				
7.	9	1	Sometimes the foams don't fit right.	1	When the foams don't fit	1	Unless I drape the wires over the rubber cover where the CEP plugs into the helmet to get them out of the way.	0	
	10	0		0		1	When turning right	1	Left slip out in right head movement.
	11	0		0		1	Hang up on nape strap and collar.	1	When wires pull.
	12	0		0		1	Wires get caught on collar and nape strap.	1	Only when wires are caught.
	13	0		0		1		1	A few times but only when they are very dirty.
	14	0		1	The plug does not form shape as readily as the yellow foam earplugs. Hard to insert.	0		1	If not properly inserted it tends to come loose.
	15	1	Sliding the helmet over the plugs.	0		0		0	
	16	0		0		1	Wires catch on goggles sometimes.	0	
	17	0		0		1		0	
	18	1	Did not fit, fall out.	1		1		1	
	19	1	Foam does not expand fast enough and cord pulls earplug out.	1	Little plastic tubes can scrape inner ear.	1	The wires pull on my earplugs when I turn my head	0	
	20	0		1	Occasionally the plastic insert extends beyond the foam and pokes me in the ear.	1	Only when I have them stuck on something behind me.	0	
	21	0		0		1	Sometimes the wire catches and tugs on the earplugs.	0	
	22	1	Hurt the ears with the probe going down the canal.	0		0		1	Because they hurt, I would leave them loose.
	23	0		0		1	Every once in a while if wires are twisted.	0	
8.	1	1	Originally I was given a small and sometimes have a hard time with goggles aligning.	0		0		0	

Q1 Unit location	Q1 ID	Q14 Difficulty in fitting CEP Num	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight			
8.	2	0	0	1	Every time I turn to the left, my right earplug gets pulled on.	1	Right ear plug does not fit properly, not known if it is my ear or the foam plug.	
	3	1	Started off with standard length which caused discomfort in my ear canal because of length. Switched to short which eliminated the problem.	0	1	They hang up on shoulder harness and upturned flight suit collar.	1	When the wires hang or pull.
	4	0	0	1	1	1	You must ensure a very good fit prior to flight to ensure they stay in.	
	5	0	0	0	0	0		
	6	1	1	1	1	1		
	7	1	1	1	1	1		
	8	0	1	Just a slight discomfort	1	They catch on the nape of my neck, especially when sweating.	0	
	9	0	0	1	1	They get caught on the flight suit collar, safety harness, ICS cord, NVG retention strap.	0	
	10	1	The foam plugs are too mushy and start to expand very quickly. The housing hurts when it is pressed by earcups.	0	1	1	Seldom	
	11	0	1	Discomfort after 2 hours.	0	1	Sometimes	
	12	0	1	Initially there was discomfort after flying for 1 hour or more.	1	Excess wire catches on clothing and other wires.	0	
	13	1	Very narrow ear canals - must trim the slim ones even slimmer - plus the foam spins off tot easily.	1	1	Inner tube too rigid - scrapes inner ear	1	They catch on everything
	14	0	0	0	0	0		
	15	0	0	1	1	0		

Q1 Unit location	Q1 ID Num	Q14 Difficulty in fitting CEP	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight			
8.	16	0	0	1	Usually occurs after 2 hours of flight. Wires hang up on my neck and when I turned my head - it pulls the plug out.	0		
	17	1	Constantly jabbed ear when inserting them because my ear canals are irregularly shaped	1	Same as #14	0	1	Due to my ears. As in #14
9.	1	0		0		0		
	2	0		0		0		
	3	1	Finding the right size plug and keeping it in the ear canal.	1	Scraping of canal	1	1	See #14
	4	0		0		0		
	5	0		1	After prolonged wear the center tube irritates the ear canal.	1	1	The wires catch on seat belts and other items. In the South with the humidity the wires stick to your neck and pull out when you turn your head.
	6	0		0		0	1	Occasionally when wearing other cords around the neck (NVG cord, flashlight)
	7	0		0		0	1	Sometimes on long flights
	8	0		0		0	1	The center core sometimes prohibits the sponge insert to compress small enough for proper fit.
	9	0		1	They are too big.	1	1	Turning my head hard to my left pull on the left side plug wire.
	10	0		0		0		
	11	0		1	The edges on the end are sharp	1	1	The Velcro comes loose with NVG battery pack installed
	12	1	May need slim plugs	1	May be too large.	0	0	

Q1 Unit location	Q1 ID	Q14 Difficulty in fitting CEP Num	Q15 Discomfort inserting CEP	Q16 Wires pull on CEP when turning head	Q17 CEP move in/out of ear during flight
9.	13	0	0	1	1 When it gets caught on flight vest and there is head movement.
	14	0	0	1	1
	15	0	0	1	0 Wires tangle in/on other wires and attachments.
	16	1	1	0	1 After 30 minutes -1 hour when flying in hot and humid environments (86+ degrees. Sweating caused the CEP to slip out during flight.
10.	1	0	0	1	0 Sometimes I think it is when the wires are more toward the cheek than the chin.
<b>Overall Total</b>	<b>N = 152</b>	<b>Yes = 35 N = 117 NR = 0</b>	<b>Yes = 50 N = 100 NR = 2</b>	<b>Yes = 114 N = 38 NR = 0</b>	<b>Yes = 70 N = 81 NR = 1</b>

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
1.	1	Just right	Just right	0	0	1	20 hours	Wash in flight suit	0
	2	Just right	Just right	0	1 Sometimes it will interfere with NVG power cord	1	25-30 hours	Wash them with my flight suit	0
	3	Just right	Just right	0	1 Power cord to NVG battery pack	1	Insufficient #s to know	N/A	0
	4	Just right	Too long	0	0	1	Haven't yet		0
	5	Just right	Too long	0	0	0 I don't know of another place.	20	rubbed between hands with soap.	1
	6			0	1 Sometimes. See #16	1	Cleaned about 25 hours	wash in hands with soap	0
	7	Too short	Too long	1 Same as above	0	1	5 hours	Wash in flight suit	1
	8	Just right	Just right	0	1 Earcups when putting helmet on	1	Haven't	Haven't	0
	9	Just right	Just right	0	1 Sometimes. See #16	1	When they get dirty	Put them in my flight suit pocket during laundering.	0
	10			1 Wire gets hung up and hard to find and secure.	1 See above	1	N/A, only lasted three flights	N/A	0
	11		Too long	0	1	1	Once every three months	Washed with uniforms	0
	12	Just right	Just right	0	0	1		Washed in flight suit pocket	0
	13	Just right	Just right	1 Sometimes the CEP wire gets caught on all of the other wires hooked to the back of the helmet	1 See above	1	Whenever they appear dirty	Left them in my flight suit pocket and washed it	1
	14	Just right	Just right	0	1 Sometimes on your clothes	1	10 hours	In the pocket of ABDUs in washing machine	1
	15	Just right	Just right	0	1 As described in #16	1	Bi-weekly	In flight suit in washing machine	0

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
1.	16	Just right	Just right	1 Sometimes when turning head one of the CEPs would pull - wire adjustment fixed problem	0	1	Each week	In sleeve pocket normal wash	0
	17	Too short	Too short	0	1 Helmet wire, seat back	0 In earcup, or separate volume controls on helmet	Didn't work long enough		1
	18	Just right	Just right	0	0	1	40-50 hours	Didn't	0
	19	Just right	Just right	1 Same as above. See Q #15-17	1 NVG strap catches it and pulls CEP from ear	1	10 hours	In wash	0
	20	Too long	Too long	1 NVG neck cord. See #16	1 NVGs	1	I didn't	I don't	0
	21	Just right	Too long	0	0	1	50 hours	Mild detergent	0
	22	Just right	Just right	0	0	1	10 hours	Soap and water	0
	23		Just right	0	0	Move on the side			0
2.	1	Too short	Too short	1 Getting tangled with the NVG battery pack.	0	1	3 months/100 hours	Just get new ones.	0
	2	Just right	Just right	0	0	1	25 hours		0
	3	Just right	Too long	0	1 It catches on intercom wire and seat belt.	1	50 hours then replace	Washed in washing machine.	0
	4	Just right	Just right	1 Velcro rubs on neck. Get rid of Velcro.	1	1	30 days garrison, 10 days field	N/A	0
	5	Too short	Too long	1 See #16	1 See #16	1	Every month	Washed with uniform	0
	6	Just right	Just right	0	1 Catches on survival vest and pulls out of ears	1	50 hours	Wash in flight suit	1
	7	Just right	Just right	1 As stated in #16	0 Except as above	1	20 hours	Wash in pocket of flight suit	1

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
2.	8	Too short	Too short	0	0	1	After each flight	Wash in flight suit pocket	1
	9	Just right	Just right	0	0	1	10-20	Soapy water	0
	10	Just right	Too long	1 See #16	1 Wires catch on nape strap buckle	1	60-70 hours	Was told not to clean - get new ones	0
	11	Just right	Just right	0	1 See #16	1	Do not have any to replace. Need more foam inserts	Warm water	1
	12	Just right	Just right	0	1 ICS cable has at times pulled from my ear canal	1	30	Just changed them out	0
	13	Too short	Too long	0	1 Long wire gets caught on vest	1	20	Wash in flight suit pocket	0
	14	Just right	Too long	0	1 Vest - pinches between vest and neck	1	Not cleaned yet	Still work. Don't break up a good thing	0
	15	Just right	Too long	0	0 Very infrequently	1	30 hours	Hand wash in soap and water	0
	16	Too short	Too short	0	1 NVG flight on battery pack wires	1	10	Washed in flight suit	0
	17	Just right	Just right	1 Speaker cutting in and out	1 Shirt/ goggle	1	10-15	Wash with flight suit or exchanged	1
	18	Just right	Too short	0 Wires would be attached to bottom of helmet up to the point at the bottom of the ear covers (cups)	1 Anything behind neck	1	Not many	Got new ones or washed with uniform	
	19			0	0	0 It should be inside, under CEP, to minimize. Wires are always in the way	Once a week	soap and water	0

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
2.	20	Just right	Just right	1 Can sometimes get caught on things in the aircraft or tangled in other helmet mounted equipment	1 Can sometimes get caught on other equipment but has little effect on job performance to the negative		130 hours	Didn't	0
3.	1	Too short	Just right	1 Gets tangled with NVG cord	1	1	25-30	Soap and water	0
	2	Too short	Just right	1 Stem broke-earplug stuck in	1 50% vest	1	Every time wash flightsuit	Leave in flight suit pocket and clean in washer	0
	3	Too short	Just right	0	0	1	20-30	Leave them in left shoulder pocket during washing	0
	4	Too short	Too short	1 See #16	1 See 16,19		Every two weeks or as needed	Wash them	0
	5	Too short	Too long	0	1 Wire length too short or long and limited space in a/c	0 L or R side of helmet	50	Hot water	1
	6	Just right	Just right	1 See question 16	0	1	Monthly	Put in pocket when washing flight suit	0
	7	Just Right	Just right	1 Installing the CEP in the back of the helmet at night occasionally proves difficult	0	1	occasionally	Placed in pocket of flight suit and laundered.	1
	8	Just right	Just right	1 With the application of ODAs and NVGs that is too many items attached to our helmet	1 See 19	0	Never did	Didn't	0
	9	Just Right	Just Right	0	0	1	100	Wash/laundered	1
	10			0	0	1	unknown	Wash with flight suit	0
	11	Too long	Too long	0	0	1	150	Replaced	0

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
3.	12	Just right	Just right	1 Too many wires	1	1	6	Washed in flight suit pocket	1
	13	Too short	Just right	0	0	1	15	Washing machine - in pocket of clothes	1
	14	Too short	Too short	0	0	1	150	Replaced	0
	15	Too long	Too long	0	1 ICS cord and vest	1		Stopped using	1
	16			0	0	0	Did not wear long enough		0
	17	Just right	Just right	0	1	1			0
4.	1	Too short		0	1 Vest or goggle mount	1		Wash	
	2	Too short	Too short	0	1 Collar	1	Every month or so.	Washed them in my flight suit.	0
	3	Too short	Just right	0	1 Only to the extent of inconvenience.	0	The side, if not, just make it easier to plug in with gloved hand.	Left in flight suit while laundering	0
	4	Too short	Too short	1 Same as day	1	0	Each time	Water	0
	5	Just right	Just right	1 You have to make sure you have all your ALSE gear on before you put on your CEP.	1 Too many wires in the cockpit, i.e. NVG commo..	1	5 hours	Put in flight suit then washed it.	1
	6	I don't know.	I don't know.	0	1 Seatbelt	0	30-40 hours	In my hand with soap.	0
	7	Too short	Just right	0	0	0	It's hard to get plugged in. I don't think moving it would help.	Haven't cleaned	0
	8			0	1 Not too bad	1			0
	9	Too short	Too short	1 Fall out	1 NVG neck piece	0	Bigger and easier connection	wash	1

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up				
5.	1	Too short	Too short	0	1	Wire tends to lodge under shoulder restraint and pull loose.	1	N/A	N/A	0			
	2			0	0		1	40	Soap and water.	0			
	3	Just right	Just right	0	0		1	Clean weekly	By hand with soap and water.	0			
	4	Too short	Just right	0	0		1	About 10	Left them in flight suit pocket and washed flight suit.	1			
	5	Just right	Just right	0	1	See #16	1	Have not cleaned them yet.		0			
	6	Too short	Too short	1	1	Going thru the process of plugging in the CEP to the helmet	0	See #16	0	On the back with finger guides to the CEP hole, thus requiring you not to look at where the plug in is.	6	Warm soapy water then rinsed them in hand under sink.	0
	7	Just right		1	0	Sometimes it tangles around the aircraft battery.	1	50 hours	Water	0			
	8	Just right	Just right	0	0		1	I'll never tell.	In flight suit and normal wash cycle.	0			
	9	Just right		0	1	Refer to #16.	0	Hard to put in with helmet on	Haven't yet.	N/A	0		
	10	Too short	Just right	0	0		1		Didn't change them yet.	Washed in machine in pocket of flight suit.	0		
	11	Didn't know they had different wire lengths.	Didn't know they had different wire lengths.	0	0		1		So far - never.	N/A	0		
	12	Just right	Too long	0	0		1		Clean them every 4 flights (10 hours).	Soap and water	0		
	13	Too short	Just right	0	0		0	On the side	Haven't had them long enough				

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
5.	14	Just right	Just right		0	1	Have not cleaned yet		0
	15	Too short	Just right	0	1 Catches on shoulder harness straps.	1	Not done yet.	Not done yet.	0
	16	Just right	Just right	0	0	1			0
6.	1	Too short	Just right	1 Initially hard to get used to because I never wore earplugs prior to the CEP modification.	0	0 Once the ECU comes on line, what are we going to do?	Monthly	Washed them IAW briefing instructions (flight suit pocket).	0
	2	Just right	Just right	0	0	0	Never	I don't, they're great.	0
	3	Just right	Just right	0	0	1	Haven't yet.	Haven't yet.	1
	4	Too short	Just right	0	0	1	10-20	In ABDU flight suit pocket in washing machine.	0
	5	Just right	Just right	0	0	0	N/A	Wash and dryer.	0
	6	Too short	Just right	0	1 See #16	1	30	Wash with flight suit.	0
	7			0	0	1	10 hours	Water	0
	8	Too long	Too long	0	1 Tends to get caught	0			0
	9	Just right	Too long	0	1 Long wire would catch on flight vest.	1	Washed with flight suit.	Regular washing.	0
	10	Too short	Too long	0	1 Catches on vest.	0 The side.	Don't wear it.	N/A	0
7.	1			0	1 Especially when wearing NVGs	1	haven't	replaced them	0
	2	Just right	Just right	0	0	1	100	Soap and water	0
	3	Too long		0	0	1	50	Tried to wipe them off with a damp cloth	0

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
7.	4			1 There are already too many wires coming off your head, There is the oversized ICS cord, 550 cord for NVG, A/C power for NVGs, ODA cord, and the CEP cord. I'd hate to think what flying in an NBC environment would be.	1 See #16	1 Perhaps two short wires located on the helmet nearest the ears. The best solution is no external contraption.	10	Soapy water and rub between fingers	0
	5	Too short	Too short	1 From time to time catches on NVG power supply cable system.	1 As explained	1			0
	6	Just right	too long	0	1	1	100	Washed with flight	1
	7	Just right	Too long	0	1 Seatbelt	1	When dirty	Placed in flight suit pocket and laundered	1
	8	Just right	Just right	0	0	1	75	I don't	0
	9	Just right	Too long	0	1 Occasionally	1	Periodically	Wash	1
	10	Just right	Too long	0	0	1	No replacements		0
	11	Just right	Too long	0	0	1		Replaced	1
	12	Just right	Too long	0	1 See #17	1	Never - too hard to replace	Soapy water	1
	13	Just right	Too long	0	0	1	60	Never cleaned, just replaced	0
	14	Just right	Too long	0	1 We wear ANVIS power cords and flotation, it tends to snag.	1	10	Replaced	0
	15	Just right	Just right	0	0	1	Kept breaking, didn't get a chance to clean them.	Didn't	0
	16	Just right	Just right	0	0	1	100	Replaced	1

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
7.	17			0	0	0	5	Water	0
	18		Too long	1	1	0 Inside	10	File 13	0
	19	Just right	Too long	0	1				1
	20	Just right	Just right	0	0	1	10-100 depending on color	When washing flight suit	0
	21	Just right	Just right	0	1 Sometimes	1	75	Replaced	1
	22	Just right	Too long	1 Same as above	1 They get hung on seatbelts behind my head.	0 Try doing it at night while on a real world mission with a 15 minute launch time.	25	Soap and water	0
	23	Just right	Just right	0	0	1	15	With flight suit in pocket.	1
8.	1	Just right	Too long	0	0	1	50 hours (1 month)	Washed in flight suit pocket with foam	1
	2	Just right	Just right	0	1 We have other wires strapped to our helmet, it tangles up.	1	Once a week	In my flight suits in the wash and air dry.	1
	3	Just right	Too long	1 Sometimes pulled by NVG power cord and ODA cable.	1 See #16 and #19	0 Inside helmet to eliminate exposed wires	50	Washed in flight suit pocket	0
	4	Too short	Too short	1 CEP wire entangles in ICS wire, ODA, NVG power supply. I'm a flying octopus.	1 Sometimes catches and restricts head movement.	1	20 hours	Soap and water	1
	5	Just right	Just right	0	0	1	Have not changed them	Have not cleaned them	0
	6			1	1	0	Never	d/n/a	
	7		Too long	0 I did not try it.	1				0
	8	Too short	Too short		1 In the OH-58D we have several other cords to contend with.	1	100	In my flight suit in the laundry	0

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
8.	9	Just right	Just right	0	1 See #16	1	45	Replace the extremely deteriorated tips.	1
	10	Just right	Just right	0	0	1	5	Washed inside flight suit pocket	0
	11	Just right	Just right	0	0	1	100	Swapped out	0
	12	Too long	Too long	1 See #16	1 Catches on NVG/ODA cord and ICS cord	1	10	Laundered in flight	0
	13	Too short	Too short	0		0 Individual wire and connector for each ear.	1 week needed replacement	Soap and water	1
	14	Too short	Too short	0	0	1	25	Threw them away	0
	15	Too short	Just right		1 The OH-58D has three other wires attached to the head/helmet and ANVIS	1	I didn't		0
	16	Just right	Just right	1 Plug pulls out. See #16.	1 Occasionally it will hang up on other helmet parts	1	100 hours	I didn't. I replaced them.	0
	17	Just right		0	0	0	10 hours	Washed in flight suit	0
9.	1	Just right	Just right	0	0	1	25 hours	Wash in pocket of flight suit	0
	2	Just right	Just right	0	1 NVG neck cord/chin strap	1	50 hours, need more tips	Leave in pocket of flight suit during wash	0
	3			1 See #16	0	1	60 or 80 hours (clean at 20-40)	Soap and water	1
	4	Just right	Too long	0	1 Long wire on vest sometimes.	1	Every 2-3 flights	Wash in arm pocket of flight suit.	1
	5	Just right	Too long	1 Extra wires are getting caught on items in aircraft.	1 They catch on seatbelts, ICS cords and stick to you.	1	20	Wash with flight suit	0
	6	Just right	Just right	1 See #16	0	1	20	Wash in flight suit	0
	7	Too short	Too short	0	0	1	100 hours	Flight suit pocket	1

Q1 Unit location	Q1 ID Num	Q18 SHORT wire	LONG wire	Q19 Night flight problems	Q20 Connector interference	Q21 Connector location convenient	Q22 Clean or change tips	Q23 Cleaning process	Q24 Wax build-up
9.	8	Just right		0	0	1	10	Inside flight suit pocket during laundry	0
	9	Too short	Just right	0	0	1		Clean them?	0
	10	Too short	Just right	0	0	1	10	Washed in flight suit pocket	0
	11	Just right	Just right	1 See #16	0	0 It would be better if all connectors were in one plug	I haven't	See above	0
	12	Just right	Just right	0	0	1	Haven't yet	Haven't yet	0
	13	Too short	Just right	0	1 Flight vest	1			0
	14	Just right	Too long	0	0	1	Clean once a week	Wash with flight suit	0
	15			0	1 Other attachment - NVG cord	0 Somewhere more convenient.	Every flight	Washed in flight suit	0
	16	Too short	Just right	1 Too many cords and wires to hook up and keep from getting tangled I.e. CEP, NVG battery pack, NVG lanyard, extension cable for battery pack, ICS cord, ODA cord!	0	1		Flight suit pocket in wash	0
10.	1	Just right	Just right	0			100, I'm lazy.	Flight suit pocket in washer	0
<b>Overall Total</b>	<b>N = 152</b>	<b>Short-Just right</b>	<b>134</b>	<b>Yes = 40</b>	<b>Yes = 78</b>	<b>Yes = 118</b>			<b>Yes = 37</b>
		<b>Long-Just right =</b>	<b>132</b>	<b>N = 109</b>	<b>N = 72</b>	<b>N = 28</b>			<b>N = 111</b>
				<b>NR = 3</b>	<b>NR = 2</b>	<b>NR = 6</b>			<b>NR = 4</b>

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
1.							
	1	1	1	0	1	When CEP comes in contact	1
	2	1	1	If inserted too far	0	2-3 hours	1
	3	0		0	0		4
	4	0		0	0		
	5	1		0	0	4+ hours	4
	6	1	1	1	Only if wire runs across ear and earcup - easy to fix.	2 1/2 hours	5
	7	1	2	0	0	2 hours	4
	8	1	2	0	0	2 hours	5
	9	1	1	Itching	0		4
	10			1	See #15	1	Ears hurt
	11	0		0	0	1/2 hour	3
	12	1	1	0	0	2 hours	4
	13	1	2	If they start to come out	1	Sometimes the wire coming out from under the earcup causes pain behind my ear.	0
	14	1	2	After 2 hours	0	1 hour	6
	15	1	2		0	1/2 hour	4
	16	0		0	0		
	17	1	2	Definitely	0		4
	18	1	2		1	It just seems the black portion's inner cylinder (not the part that the foam covers) irritates the outer portion of my ear canals	4
	19	1	1	Both itching and pain	1	In ear canal	3
	20	0		0	0	3 hours	4
	21	1	2		0		3
	22	0		0	0		5

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
1.	23	0		0	0		4
2.	1	0		0	0	4 hours	4
	2	0		0	0		7
	3	1	1 Itching	0	0	1 hour	
	4	0		0	0		7
	5	1	1 On long flights mildly uncomfortable.	0	0	2 hours	4
	6	1	2	0	0	2 1/2-3 hours	4
	7	0		0	0		4
	8	1	3	0	0	1 1/2 hours	2
	9	0		0	0		4
	10	0		1 Barrel of external earplug pressed against outside ear due to pressure from earcup	1 See #26	2.5 hours	3
	11	0		0	0		7
	12	0		0	0		4
	13	1	1	0	0	1/2 hour	2
	14	0		1 Cord - at times pinches between earcup if not positioned correctly	0 After 2.5 hours	4	1
	15	1	1 Sometimes on long flights	0	0 2 hours	4	1
	16	0		0	0		4
	17	0		0	0	3.5 hours	4
	18	1	1	0	0	1 hour	4
	19	1	2	1 Too big	0	Less than .5 hour	2

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
2.	20	1	2	1 On long missions or several flights over short period of time CEP will rest against outer ear and cause discomfort	0	1 hour	3
3.	1	1	1	itch	0	1/2	7
	2	0			0		4
	3	0			0		4
	4	0			0		7
	5	0			0	4	7
	6	0			0	1.5	5
	7	0			0		4
	8	0			0		4
	9	1	1		0		4
	10	0			0		4
	11	1	1		0	2	4
	12	0			0		6
	13	1	1		0	2	5
	14	1	1		0		3
	15	1	2		0	1/2 hour	4
	16	1	2	1 The metal part of the CEP presses into my ears	0	1/2 hour	1
	17	1	2		0	1/2 hour	4
4.	1	1	1		0	1/2 hour	6
	2	0			0		5
	3	1	2	Pain	0	1 hour	7
	4	1	3	1 Hurt	0	1/2 hour	1

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
4.	5	1	2	0	0		6
	6	1	2	0 Just canals.	0	1/2-1 hour	3
	7	0		0	0		4
	8	1	1	1 After 2-3 hours	0	3 hours	5
	9	1	1	0	0	3 hours	6
5.	1	1	1	0	0	1 hour	4
	2	1	1	0	0		5
	3	1	2 Itching	0	0	1 hour	3
	4	1	2	0	0		6
	5	1	2	0	0	1 hour	7
	6	0		0	0		3
	7	1	2	1 See #12.	0	1/2 hour	5
	8	0		0	0		4
	9	1	1 Pain	0	0	1/2 hour	4
	10	0		0	0		4
	11	0		0	0		6
	12	0		0	0		6
	13	0		0 In a way the hard part inside the foam - if not rolled slowly the plastic may scratch on inserting the earplug into the ear.	0		4
	14	0		0	0		5
	15	0		0	0		6
	16			1 See #14	0	1/2 hour	3

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort		
6.	1	1	2	Initially moderately uncomfortable	0	0	1/2 hour	4	
	2	0			0				
	3	1	1		0			4	
	4	0			0			4	
	5	0			0			6	
	6	1	1		0	1	1/2 hour	4	
	7	0			0			7	
	8	0		1	If wire lays on top of outer ear it tends to cause a hot spot.	1	See previous.	1 hour	4
	9	1	2	After 3-4 hours.	0		3 hours	4	
	10	1	3		1	The wires are pressed into my ear from the earcup.	1/2 hour	1	
7.	1	1	2		0	1	On my ear against the cushions	1/2 hour	4
	2	1	1		0		1/2 hour then subsides	4	
	3	1	1		0			4	
	4	1	2	The part that protruded from my ear is in contact w/ earmuff and after an hour of flying it becomes painful enough to take the CEPs out.	1	See #25	0	1 hour	5
	5	1	2		0		1/2 hour	7	
	6	1	1		0		1/2 hour	7	
	7	0		1	Edges feel sharp	0			

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
7.	8	0		0	0		7
	9	1	1 Only when I get the wrong size.	0	0		4
	10	0		0	0		4
	11	0		1 Size of speaker	0	1 hour	7
	12	0		0	0	1 hour	7
	13	0		0	0		7
	14	0		0	0		7
	15	0		0	0		
	16	0		0	0		4
	17	1	1 Itchy	0	0	1 hour	5
	18	1	2	1	1	1 hour	4
	19	0		0	0		4
	20	1	1 Sometimes	0	1 Occasionally	3 hours	7
	21	0		1 Sometimes just a mild hot spot from the black plastic portion pressing against the outer ear	1 See #26	1.5 hours	4
	22	1	2	0	0	1/2 hour	4
	23	0		0	0		7
8.	1	0		0	0	1/2 hour	6
	2	0		0	0	3 hours	6
	3	1	2 Only with standard foam tip	0	0	1 hour	6
	4	1	2	0	0	1 hour	5
	5	1	2	0	0	1/2 hour	3
	6	1	2	0	0	1/2 hour	1
	7	1	3	1	0	Less than 1/2	1

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
8.	8	1	1	0	0	1/2 hour	7
	9	1	2	0	0		4
	10	0		1 The housing sometimes is pressed against the ear by the helmet earcup.	0		6
	11	1	2	1 Soreness	1 In ear canals	2 hours	4
	12	1	1	1 Initial discomfort was gone after 20 hours.	0	1 hour	6
	13	1	2	1 Where the wire presses on earlobe.	0	2 hours	2
	14	0		0	0		7
	15	1	2	0	0	1/2 hour	3
	16	1	2 After long flights (2.5 hrs)	0	0	2 hours	6
	17	1	1 Itching	0	0	1/2 hour	4
9.	1	0		0	0		6
	2	1	1	0	0	1/2 hour	7
	3	1	1	0	0	1 hour	4
	4	0		1 The metal connector on the outside of ear.	0		7
	5	1	2 After 3 hours	0	0	2 1/2-3 hours	7
	6	1	1 Occasionally	0	0	1 1/2 hours	4
	7	0		0	1 Flight with NVGs	3 1/2 hours	6
	8	0		0	0		4
	9	0		0	0		3
	10	0		0	0		5
	11	0		0	0		6
	12	1	1	0	0	1 1/2 hours	7
	13	0		0	0		

Q1 Unit location	Q1 ID Num	Q25 Canal discomfort	Rate discomfort	Q26 External ear discomfort	Q27 CEP hot spots	Q28 Onset of CEP discomfort	Q29 Rate overall fit and comfort
9.	14	0		0	0		4
	15	1	2 Itching	0	0		
	16	0		1 Hard plastic when trying to keep CEP in the ear.	0		
10.	1	0		1 Sometimes with the plastic part, however with the next generation there probably won't be a problem.	0		5
<b>Overall Total</b>	<b>N = 152</b>	<b>Yes = 81</b> <b>N = 69</b> <b>NR = 2</b>	<b>Mean = 1.6</b>	<b>Yes = 29</b> <b>N = 123</b> <b>NR = 0</b>	<b>Yes = 13</b> <b>N = 138</b> <b>NR = 1</b>		<b>Mean = 4.6</b> <b>NR = 10</b>

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
1.	1	0	0	1	Next to impossible 1
	2	1	0	1	0
	3	1 Care had to be taken when putting helmet on or it pulled plug out	0	1	Cannot compress foam sufficiently to insert 1 Caused plastic post to snap off
	4	0	0	0	1 Somewhat
	5	1	0	1	Much harder to feel the helmet adapter. 1 Plastic tips sometimes scrape.
	6	1 Extra care is required to not dislodge the CEP.	0	1	They are small 0
	7	0	0	0	1 Due to the length of the cord, you rub them out of your ears.
	8	1 Without spreading ear cups the CEPs normally hit the earcups. You must also take care not to pinch the wire while adjusting the helmet.	0	1	You can't do it. 0
	9	1 Cannot put gloves on before donning helmet because I cannot put wire in helmet hole w/ gloves on.	0	1	Can't do it. What does doffing mean?
	10	1	0	1	1 Plugs were pulled out of ear abruptly
	11	1 Takes more time	0	1	Hard to put in the ear 0
	12	1	0	0	0
	13	1 Takes longer to get ready	0	0	0
	14	0	0	0	0
	15	1 You must be careful not to tug in the wires otherwise they pull the earplug out	0	0	0
	16	1 Must take special care not to pull the wires out while doffing.	0	1	Hard to compress and seat the CEP into the ear 1 Yanks the ### out of your ear
	17	1 Remembering	0	0	0
	18	1 The ear cups must be pulled over the black cylinders of as not to disturb them	0	0	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
1.	19	0	0	0	0
	20	1 You have to be more deliberate in donning the helmet	0	0	0
	21	1 Care is taken not to pull earplugs out - -thumbs are inserted in ear cups to pull the earcups over the ears	0	1 Hard to plug into helmet with gloves on	0
	22	0	0	0	0
	23	1 Must connect prior to putting on helmet	0	1 Takes longer	0
2.	1	1 You just have to be more cautious about the wires and not pulling them out.	0	1 While compressing the CEP to put into the ears, it is difficult trying to feel if you are twisting the earplug off. As far as connecting to the helmet, it is more difficult making the connection with the helmet.	1 The CEP would get yanked out of my ears.
	2	0	0	0	0
	3	1	0	1 Harder to plug in but not impossible.	0
	4	1 Careful placement of earcups around CEPs to prevent accidental dislodgment.	0	1 Cannot be done.	0
	5	1 Just need to pull earcups wider.	0	1 Locating where to plug the CEP into the helmet.	1 Ripped them out of my ears.
	6	0	0	0 I always insert w/o gloves on	0
	7	1 Just hook-up/un-hook in sequence	0	1 Sometimes hard to seat with connector with gloves.	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
2.	8	1 More crap to plug in! We already have too much crap attached to our heads.	1 You've apparently never tried this yourself.	1 It hurt like hell	1
	9	1 Have to pull the earcups further apart so that they don't pull CEPs out	0	0	0
	10	1 Expand earcups further/ extra time to put on	0	1 Can't use gloves	0
	11	1 Must pull earcups out to avoid CEP pulling out	0	1 Never done it	0
	12	1 It takes just a few more seconds to connect	0	1 Cannot feel the HGU-56 connector to insert the CEPs	0
	13	1 Must spread helmet earcups apart further	0	1 Getting proper fit sometimes takes 2-3 tries with gloves on. Gloves get CEP dirty quickly	0
	14	1 Having to undo shin strap to allow total expansion of ear cups in order not to pull CEP	0	1 No way can I place the CEP in the ear with glove on (same as regular earplugs). Plus connector into helmet is hard to find hole	0
	15	1 Must be careful not to pull them out when donning helmet	0	1 Hard to plug into back of helmet with gloves on	0
	16	1 You must pull helmet wider apart to keep CEPs from getting worked out by ear cups	0	0	0
	17	0	0	1	0
	18	1 Only if CEP is caught on something and pulls out of the ear canal	1 Only when facing time constraints	1 I was only able to insert foam tips without my gloves	0
	19	1 Very difficult process	1 Wires in the way and distracting pain	1 Can't feel	0 Relief!!
	20	1 Must be careful donning helmet otherwise CEP can be brushed out of the ear canal	0	0	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
3.	1	1	0	1	0
	2	1 Must pull bottom of earcup out so as not to pull out CEP from ear	0	0	1 Minor irritation as earplugs pull out of ear
	3	1 It takes longer to be ready for flight, also tends to get tangled with NVG retaining cord	1 In combat situation when you need to be airborne in a hurry it could interfere	1 Negligible	0
	4	0	0	0	0
	5	1 It takes some time donning so the CEP is not pulled out	0	0	0
	6	0	0	0	0
	7	1 Slows down the process slightly	0	1 It is impossible. I have to don/doff without gloves on	0
	8	1 You now have to place your helmet on so it won't pull on the wires	0	1	0
	9	0	0	0	0
	10	1 The fall out easily when putting on the helmet	0	0	0
	11	0	0	1 Must remove gloves to plug CEP in	0
	12	1 Have to stretch helmet out farther	1 If you touch earplugs at all it eventually falls out	1	1 pulled out of ear
	13	1 Insert earplugs first, attach earplug to helmet, pull helmet on carefully, keep earcups pulled out as you don helmet	0	1 Need the hand agility and sensitivity to feel where plugs need to go	0
	14	0	0	1 Cannot compress foam to place in ear	0
	15	1	0	1	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
3.	16	1 You must connect the CEP to the back of the helmet after donning it	0	1 I can't seat them with gloves. But I can't seat foam earplugs with gloves either	0
	17	1 Must use side to side method	0	0	0
4.	1	1 You must pull earcups back to place over plugs and back, nape strap has trouble sliding out.	0	1 Think about it.	1 It yanked on my ear.
	2	1 Must slip one ear on at a time to avoid pulling CEP out.	0	1 Less feeling	0
	3	1 Increases time	1 It's just one more wire to put on, in addition to all the other equipment. It's not a habit yet.	1 It's easier to don with gloves off in order to plug in CEP to helmet.	0
	4	1 Knocks plugs out	1	0	0
	5	1 Pulling earcups wider to pull it over the CEP.	0	1 The gloves create a different feel to the CEP. Plus the CEPs are small and hard to move around with gloves on.	0
	6	1 You really have to watch out for those wires.	0 Unless its an immediate launch thing then I will just not use the earplugs.	1 I don't use the gloves because its impossible to find the plug for the CEP with them on.	1 The plastic digs the ear canal.
	7	1 I have to pull the helmet out from my ears as I put it on to keep from knocking out the earplugs.	0	0	1 Hurts my ears. I only did it once though!
	8	1 Takes more time.	0	1 Gloves on last	0
	9	1 Makes them fall out	0	1 Connection is too small.	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
5.	1	1 Must be extremely careful in placing the earcups over the ears since the plugs come out easily.	0	1 Lack of dexterity, feeling with gloves.	0
	2	1	0	1	0
	3	1 Helmet must go on before run-up so you can connect wires before gloves are donned.	0	1	1 Pain when plugs are pulled from ears.
	4	1 You have to remember to connect the wires to the helmet after you put the helmet on.	0	1 With the gloves on, it's hard to put the small tip/connector of the CEP into the plug on the helmet.	0
	5	1	0	1 Have to remove gloves to connect CEP into jack.	0
	6	1 This is the real problem with this product. You must plug in the CEP in your ears, then put on your helmet and lastly plug in your CEP to the helmet.	1 If we are in a hurry... Yes we hurry in aviation! Properly fitting the CEP is a hassle and induces more stress because it requires more time and patience when fitting.	1 You need to feel the device to fit it properly due to dexterity loss when wearing gloves.	0
	7	0	0	0	0
	8	1 The sides of the helmet must be stretched outward just a little extra to ensure not to snag the CEP loose.	0	1 Gloves on is difficult. It however is no problem to put gloves on after inserting CEPs into ears, and connecting to the back of the helmet.	0
	9	1 Have to put the wire in after donning the helmet.	0	1 Can't do it yet.	0
	10	1 You must grasp earcups and spread out to go over ears, to ensure you don't knock the earplugs out of your ear.	0	0	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
5.	11	1 I put the helmet on early in the run-up procedure. It takes a little more time.	0	1 The gloves make it hard to fit into my ears and connect to the helmet.	0
	12	1 Takes longer	0	1 Lose to much dexterity	0
	13	1 Pull the earcups out further to ensure they do not snare the wires.	0	1 Same as yellow earplugs. Fingers are not as nimble with gloves.	
	14	1	0	0	0
	15	1 I have to get careful not to pull them out when the earcups contact the wires.	0	1 I cannot plug them into the helmet with gloves on.	0
	16	1	0	1 Can't be done with gloves.	
6.	1	1 A lot more time and more tenderness involved.	0	0	1 The other pilots break the transducer wire on the right ear, next to the bottom or the transducer.
	2	1 It takes longer.	0	1 My hands are to clumsy with gloves.	0
	3	1 You have to be really careful when using NVGs or the mic cord. The CEP cords have to be on top of everything else.	0	1	0
	4	1 More careful placing helmet ear cups over ears to prevent them falling out, plus additional step of plugging in connector.	0	1 Can't get plug in helmet.	0
	5	0	0	0	0
	6	0	0	1	0
	7	0	0	1	1
	8	0	0	0	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
6.	9	0	0	0	0
	10	1 Have to pay close attention to the wires.	1 It is awkward.	1 Can't feel wires.	0
7.	1	1 Just have to plug in CEPs	0	0	1 It is rough getting pulled out of my ears
	2	0	0	0	1 The helmet pulled the plugs from the ear canal
	3	1 I hold the earcups away from my ears so they don't pull the earplugs out	0	1 It is hard to locate the connector on the helmet to plug the earplugs into with gloves on	0
	4	1 It' one more thing to do before you fly.	0	1 Putting any hearing protection w/gloves on is	0
	5	0	0	0	0
	6	1 Must undo chin strap completely to don helmet.	0	1 I plug in the CEP into helmet prior to putting on my gloves.	0
	7	1 Insert CEP, once helmet is on and aircraft is 100%, plug in CEP.	0	1 CEP too small	0
	8	1 I must carefully fit the ear portion of the helmet over the ear plugs.	0	0	0
	9	1 Have to be careful going over ears.	0	0	0
	10	1 Must be careful not to pull out plugs	0	0	0
	11	1 Put CEP in first and position wire not to get caught up on helmet.	0	1 Can't feel the wires.	0
	12	1 Put earplugs in first then wear helmet and	0	0	0
	13	1 At first the earcups had to be pulled outward significantly to keep the CEPs from being pulled out, but with experience its much easier.	0	1 I can't insert properly so I remove the gloves to insert the CEP.	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet	
7.	14	1 You must be careful to remove the plug prior to doffing the helmet. I put my gloves on after the helmet to allow for easy plugging in.	0	1 The recessed jack is hard to find when gloved.	1 It pull out of your ears and breaks the speaker stems.	
	15	1 I have to spread the helmet apart so it won't catch on the ear plug and break off	0	1	0	
	16	0	0	1	0	
	17	1 Slower	0	0	0	
	18	1	0	1	1	
	19	1 You have to hook up the wires - duh .	0	1 Can't properly insert connector with gloves on.	0	
	20	1 I have to hold the earcups open more. Not a problem.	0	1 Cannot find the plug-in w/gloves	0	
	21	1 Need to spread the helmet/earcups more to slip over my ears w/o pulling out CEP.	0	Never have tried it. Always put them in without gloves on.	0	
	22	1 Have to put them on out of the normal sequence for me. I have to wait to strap in. Refuel is where most problems occur. Getting out then in.	1	1 When you are in a hurry it is hard to use them.	1 Too hard to do with gloves.	1 Just hurt if it didn't break.
	23	1 You have to connect the wire.	0	1 I usually put on my left glove then attach the wire and then put on my right glove.	1 The earplug rip out of your ear.	
	8.	1	1	0	1 I do it without gloves.	0
		2	0	0	0	1 Pulled on my ear canal.
		3	1 Requires earcups to be pulled apart more to prevent knocking plugs from ears.	0	1 Difficult to locate plug and plug it in the back of the helmet.	0

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet			
8.	4	0	0	1	Finger tip dexterity w/gloves does not allow for easy plug in of CEP.	1	Wires pulling earplug out.	
	5	1	You must pull the earcups out further.	0		0		
	6	1		0		1		
	7	1		1		1		
	8	1	I must leave one glove off until my helmet and CEP is on.	0	1	See #31	0	
	9	1	Carefully spread the earcups and gently slide over the CEPs.	0	1	Not enough feeling to guide the helmet on without knocking the CEPs out of the ear.	0	
	10	1	Slower, more deliberate.	0	0		0	
	11	0		0	1	Never wear gloves (impossible)	0	
	12	1	Must use caution not to dislodge the CEP when donning the helmet	0	0	I do not attempt	0	
	13	0		0	1	Do it before you put your gloves on.	1	Ripped it out of my ear!
	14	0		0	0	But could be in a combat environment.	0	
	15	1	Additional steps to connect the CEP	0	1	I can do it but is more difficult.	0	
	16	1	Takes more time to don. Also you have to make sure that everything is positioned right so you don't hang up the cord and pull it out during	0	1	I can't. My gloves have to be off otherwise there is not enough sensitivity.	1	Mild pulling throughout ear canal.
	17	1	It is a pain to try to fit it up to the helmet.	1	1	I'm in a time constraint and it always happens that I can't get it hooked up or it rips my ears off when I take it off.	1	Ripped my ears off !!!

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
9.	1	0	0	0	0
	2	1 Added time chasing wires.	0	1	0
	3	1 Requires adjustment to get over plugs and wires.	0	1 I can't do it.	0
	4	0	0	0	1 Yanks them out of ear.
	5	1 Takes a few seconds more to get the helmet on so you don't pull the earplugs out.	0	1 Your sense of feel is poor with gloves so its hard to feel the plug.	0
	6	1 Have to remember to plug earplug into helmet.	0	1 Hard to find insert point on helmet.	1 Pulls CEP out of ears.
	7	1 Using earplug with helmet.	0	1 Unable when putting on helmet	0
	8	0	0	1	0
	9	1 More things to hook up!	0 Just aggravating	1 Have to have gloves off.	0
	10	1 Plug in connector after donning helmet	0	0	0
	11	1 It takes some practice to put the earplugs in and put the helmet on without pulling the earplugs	0	1 I can't do it.	0
	12	1 Takes a minute or so longer.	0	1 Can't do it.	0
	13	1 Much more time is required.	0	1 Parts are too small and intricate.	
	14	1 Earplugs in, cord over right shoulder, helmet on, plug in, climb in.	0	1 Hard to insert with gloves on.	1 Yanks ears off.
	15	1 By virtue of more plugs and hardware.	0	1 Loss of dexterity - can't do it.	1 Yanks ears off.
	16	1 Must be careful not to touch CEP. It will fall out or become unseated.	0	1 Impossible	1 Wires are pulled loose from helmet connector

Q1 Unit location	Q1 ID Num	Q30 Problem donning/doffing helmet w/CEP	Q31 Significant problem completing mission w/extra step	Q32 Problem don/doff w/gloves	Q33 Discomfort if forget to disconnect CEP from helmet
10.	1	1 I have to be a little more careful ensuring that the earcups go over my ears so as not to pull out the CEPs.	0	1 Can't do it, but it's no problem.	
<b>Overall Total</b>	<b>N = 152</b>	<b>Yes = 121</b> <b>No = 31</b> <b>NR = 0</b>	<b>Yes = 12</b> <b>No = 139</b> <b>NR = 1</b>	<b>Yes = 102</b> <b>No = 48</b> <b>NR = 2</b>	<b>Yes = 36</b> <b>No = 111</b> <b>NR = 5</b>

Q1 Unit location	Q1 ID Num	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate gender clarity (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire	
1.	1	4	7	7	7	7	5	7	3	6
	2	6	7	7	7	7	7	7	7	7
	3	3	6	4	4	6	6	6	6	6
	4	3	6	6	5	6	4	6	3	4
	5	3	7	7	7	7	6	6	5	4
	6	4	7	7	7	7	7	7	4	7
	7	3	7	7	7	7	6	6	6	5
	8	1	7	7	7	7	4	7	4	4
	9	4	7	7	7	7	7	7	5	5
	10	3	5	4	4	5	4	5		
	11	3	7	7	7	7	7	7	3	6
	12	3	7	4	4	7	5	5	4	4
	13	2	7	6	6	6	6	6	3	6
	14	4	7	7	7	7	7	7	4	7
	15	3	7	6	6	7	6	4	3	5
	16	4	7	7	7	7	7	7	3	6
	17	4	6	6	6	6	4	4	4	4
	18	3	7	7	7	7	6	6	6	6
	19	4	7	7	7	7	7	7	6	6
	20		7	7	7	7	7	7	3	7
	21	3	7	7	7	7	7	3	1	7
	22	4	7	7	7	7	7	7	7	5
	23		6	6	6	6	6	4	4	4
2.	1		7	7	7	7	7	7	2	7
	2	4	7	7	7	7	6	5	4	7

Q1 Unit location	Q1 ID Num	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate gender clarity (Male) (Female)		Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
2.	3	3	7	6	6	6	7	6	3	5
	4	4	7	6	7	7	6	7	4	4
	5	4	7	7	7	7	6	6	2	6
	6	4	7	6	6	7	7	7	3	6
	7	4	7	7	7	7	4	6	4	4
	8	1	7	7	7	7	7	7	6	7
	9	4	7	7	7	7	5	7	5	7
	10	2	7	7	7	7	3	1	4	3
	11	3	7	7	7	7	7	7	7	7
	12	4	7	7	7	7	6	7	6	6
	13	3	6	6	6	6	6	6	5	6
	14	2	7	4	4	7	7	7	2	6
	15	3	7	7	6	7	4	7	2	5
	16	4	7	7	7	7	4	7	4	4
	17	4	6	6	6	6	6	7	3	5
	18	3	7	7	7	7	7	7	4	6
	19	3	6	7	7	7	4	4	4	5
	20	4	7	7	7	7	4	7	6	4
3.	1	4	7	7	7	7	7	4	6	7
	2		7	7	7	7	7	7	4	5
	3	4	7	7	7	7	7	7	7	7
	4	6	7	7	7	7	7	7	7	7
	5	7	7	7	6	7	7	7	7	7
	6	4	7	7	7	7	7	7	7	7
	7	3	7	7		7	4	7	4	4

Q1 Unit location	Q1 ID Num	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate gender clarity (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
3.	8	4	6	6	6	5	4	4	4
	9	4	6	6	6	6	5	6	7
	10	4	7	7	7	6	7	3	6
	11	4	7	7	7	4	7	4	4
	12	2	6	6	6	6	6	4	6
	13	3	7	7	7	6	6	3	5
	14	4	7	7	7	4	7	3	4
	15	4	7	6	6	4	4	4	4
	16	3	5	5	5	4		4	4
	17	4	4	4	4	4	1	4	
4.	1	3	7	6	6	6	7	6	6
	2	2	7	7	7	7	7	5	3
	3	1	7	7	7	7	7	6	6
	4	1	4	4	4	4	4	4	4
	5	6	7	5	5	5	6	6	6
	6	2	5			5	5	4	3
	7	3	7	7	7	7	7	7	7
	8	5	7	7	7	7	7	5	5
	9	4	7	7	7	7	7	7	7
5.	1		7	7	7	3	7	3	
	2	4	5	5	5	5	7	5	5
	3	3	7	7	7	7	7	5	7
	4	6	7	7	7	7	7	7	6
	5	3	7	7	7	7	7	3	

Q1 Unit location	Q1 ID Num	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate gender (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
5.	6	3	7	4	4	6	7	4	4
	7	5	7	7	7	7	7	7	7
	8	4	7	7	7	6	7	6	6
	9	3	7	7	7	3	7	4	4
	10	4	7	5	6	7	7	7	5
	11	4	7			7	7		5
	12		7	7	7	7	6	2	6
	13	4	7	7	7	4	7	4	
	14	4	6	6	6	6	6	4	
	15	6	7	7	7	4	7	4	
	16	3	7	7		7	1	4	
6.	1	5	6	6	6	5	5	6	6
	2		6	6	6	7	7	3	7
	3	4	7	7	7	4	7	7	4
	4	2	7	7	7	7	6	7	4
	5	4	7	7	7	7	7	7	7
	6	4	7	7	7	3	7	3	2
	7	7	7	7	7	7	7	7	7
	8	4	7	7	7	4	7	3	5
	9	4	7	6	7	6	5	6	5
	10	1	1	1	1	1	1	5	1
7.	1	4	7	7	7	7	7	7	7
	2	3	7	7	7	4	7	7	3
	3	3	7	7	7	6	7	4	6

Q1 Unit location	Q1 ID Num	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate gender clarity (Male) (Female)		Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
7.	4	3	6	6	6	6	2	4	4	2
	5	6	7	7	7	7	7	7	6	6
	6	4	7	7	7	7	3	7	7	4
	7	3	6	6	6	6	6	7	6	6
	8	7	7	6	6	7	7	7	7	7
	9	4	6	6	6	6	4	6	4	5
	10	4	7	7	4	7	7	7	7	7
	11	7	7	7	7	7	7	7	7	4
	12	7	7	7	7	7	7	7	4	4
	13	4	7	7	7	7	4	7	4	6
	14	6	7	4	4	7	6	7	6	6
	15		7	7	7	7	7	7	3	6
	16	4	7	7	7	7	5	7	5	4
	17	5	5	5	4	5	5	5	5	5
	18	4	5	5	5	5	5	5	4	5
	19	2	7	7	6	7	3	7	3	3
	20	4	7	7	7	7	7	7	3	7
	21	4	7	7	7	7	7	7	2	7
	22	2	7	6	6	6	4	4	4	4
	23	4	7	7	7	7	7	7	7	6
8.	1	4	7	7	6	7	7	7	4	7
	2	6	7	6	6	7	2	6	7	2
	3	3	6	6	6	6	4	6	5	4
	4	2	7	6	6	7	7	6	3	4
	5	5	7	7	7	7	7	7	3	6

Q1 Unit location	Q1 ID Num	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate gender (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire
8.	6		5	4	4	4			
	7	1	1						
	8	3	7	7	7	3	4	5	3
	9	3	5	5	5	5	7	3	5
	10	2	7	7	7	4	7	4	
	11	4	7	6	6	7	3	3	7
	12	4	7	7	7	3	7	4	4
	13	3	7	7	7	7	7	4	7
	14	7	7	7	7	7	7	7	4
	15	3	4	4	4	4	4	4	4
	16	2	6	6	6	3	7	4	4
	17	2	5	5	5	5	4	5	4
9.	1	5	7	6	6	7	6	5	
	2	4	7	7	7	7	7	7	7
	3	3	7	7	7	5	5	4	7
	4	7	7	7	7	6	6	6	7
	5	6	7	6	6	7	7	7	7
	6	4	6	6	6	4	6	3	
	7	3	7	5	5	5	6	6	6
	8	4	7	7	7	7	7	7	7
	9	3	7	7	4	6	6	6	
	10	4	5	5	5	5	5	4	6
	11	3	4	4	4	4	4	4	
	12	3	7	4	4	7	7	4	4
	13	3	7	4	4	7	7	3	4

Q1 Unit location	Q1 ID Num	Q34 Rate donning/doffing	Q35 Rate ICS clarity	Q36 Rate gender clarity (Male) (Female)	Q37 Rate overall speech clarity	Q38 Rate noise reduction	Q39 Rate warning signals	Q40 Rate monitoring A/C noises	Q41 Rate weapons fire	
9.	14	4	6	6	6	5	6	3	6	
	15		4	4	4	4				
	16		7	7	7	6	6	3		
10.	1		7	7	7	6		4	5	
<b>Overall Total</b>	<b>N = 152</b>	<b>M = 3.7</b> <b>SD = 1.3</b> <b>NR = 12</b>	<b>M = 6.6</b> <b>SD = 1.0</b> <b>NR = 0</b>	<b>M = 6.3</b> <b>SD = 1.1</b> <b>NR = 3</b>	<b>6.2</b> <b>1.1</b> <b>9</b>	<b>M = 6.5</b> <b>SD = 0.9</b> <b>NR = 3</b>	<b>M = 5.6</b> <b>SD = 1.5</b> <b>NR = 1</b>	<b>M = 6.2</b> <b>SD = 1.4</b> <b>NR = 6</b>	<b>M = 4.7</b> <b>SD = 1.5</b> <b>NR = 5</b>	<b>M = 5.3</b> <b>SD = 1.4</b> <b>NR = 17</b>

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
1.			
	1	0	Poor construction of CEP. The CEP needs to be more durable.
	2	0	Sometimes. Hot spots will develop inside the ear canal if plugs are inserted too far in.
	3	0	See above
	4	0	
	5		
	6	1 They are too fragile. I love the CEP. They take a little extra time to install but the benefits are worth it.	The cord catches on things and will dislodge from the ear. It is very difficult to install them in-flight.
	7	0	The only problem I have with the CEPs is that over time, extended mission over 2 hours, the CEPs tend to slop out of your ears. Also the center post tends to dig into your inner ear over long missions witch makes them uncomfortable.
	8	0	
	9	0	
	10		
	11	0	
	12	0	
	13	0	Once the wires are strengthened the device will be better
	14	0	No problems
	15	1 They are not built to handle serious wear and tear.	During extended periods of wearing the CEPs they make the ear canal ache.
	16	0	
	17	1 They are too fragile. Mine broke after roughly 25-30 hours of use and my ALSE technician was not trained or probably equipped to repair the items	
	18	0	
	19	0	Sore ear canals
	20	1 easy to lose	
	21	0	Continuous use (4 days in a row of 4-hour flights each day) results in ear canal sensitivity
	22	0	

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
1.	23	0	
2.	1	0 It blocks out all aircraft noise.	I think the more durable parts are the way to go when making this final CEP because they go thru alot in the field and we need an inexpensive, more durable unit to provide to pilots to improve communications between aircrews, ground elements, ATC, & Commanders.
	2	0	Very delicate.
	3	0	
	4	0	Make the foam stiffer.
	5	0	In reference to monitoring noise generated by the aircraft, blocks out A/C noise and you can't hear engine and rotor noise.
	6	0	
	7	1 Foam tips fall apart after second wash and cannot stay compressed to insert in	Foam tips not durable after first wash.
	8	0	The Velcro on the left wire will drive you nuts when it falls off the Velcro in the back of your helmet. The threaded stud needs to be flexible so as to conform to the inner ear canal.
	9	0	
	10	1 Caution/ warning tones were too loud. I am used to yellow foam earplugs while flying - caution tones just right	
	11	0	Wires getting caught on other items strapped to my head or body. I have had CEPs for close to a year with no foam replacement. Mine are no good.
	12	1 The only problem that I have, is that they are made to flimsy. They need to be hardened some way. As I said, I'm on my third pair	Mine have broken right at the ear foam, where the wire connects to the foam
	13	0	Long wire caught on vest and pulled CEP out of ear. While trying to adjust this the wire broke
	14	1 CEP offers better hearing of radio traffic. A wider range of ear plug portions and stronger cord connection to plug screw portion would greatly increase the lifetime of these plugs. Aviators are very rough on equipment. Build them to	
	15	0	
	16	0	
	17	0	

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
2.	18	0	Wires easily caught on objects and pulled out of ears. When foam tips are hot and moist they will not stay collapsed long enough to insert into ear
	19	They broke within 75 hours, very uncomfortable. Maybe I was sized wrong.	Broke less than 75 hours and not comfortable
	20	0	
3.	1	0	
	2	1 Stem failure - earplug stuck in ear during flight	See above
	3	0	There is a need for ICS performance. The CEP is a good interim fix, but it is fragile and easy to lose. It takes extra time to don helmet especially when using NVGs.
	4	0	
	5	0	
	6	0	I've gotten spoiled and hate flying without them
	7	1 Cautions/warnings too loud	
	8	0 Not a big problem but just one more thing to add to a long list of small inconveniences	
	9	0	They are not very durable overall
	10	1 Hard to hear aircraft noise i.e. engine etc	Tones are too loud
	11	1 Caution warning advisory signals extremely loud	Advisories too loud
	12	0	Doesn't stay in my ear well
	13	0	Ear piece wires seem way to flimsy-they break at ear piece commonly. I was very careful not to put undo pressure/stress on system, and after 100 hours of flying, one wire reached it's useful life and broke at ear piece.
	14	0	
	15	0	
	16	1 I no longer use CEP for two major reasons: 1. They are too uncomfortable. 2. To adjust the ICS to hear radios and cockpit communication, the aircraft caution and warning audio becomes entirely too loud.	
	17	0	

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
4.	1	1 Discussed it in earlier questions.	It slides out too easily. Need smaller but more snug earplugs.
	2	0	
	3	0	
	4	1 They are uncomfortable	
	5	0	
	6	0	The foam changed after washing. It no longer holds its reduced size to
	7	0	
	8	0	
	9	0	They fall out.
5.	1	0	
	2	0	
	3	0	Difficulty getting them to stay in ear canal and some ear canal pain because of pushing them in hard so they will stay in when donning helmet.
	4	0	The speaker end of the wires would be more comfortable if they were smaller, or if they were formed and fitted for each ear.
	5	0	Some ear pain is associated with the insert but will change to a smaller size when available.
	6	0	
	7	1 The installation portion. Soldering wires together makes weak wires and eventually will break.	See #12
	8	0	No problems
	9	0	
	10	0	No problems encountered so far.
	11	0	
	12	1 During engine start I cannot hear the igniters pop or hear the engine light off.	
	13	0	
	14	0	Snags when putting the helmet on and taking it off.

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP	
5.	15	0		
	16	1	CEP make caution/warning signals way to loud.	
	6.	1	1	The CEPs were not made durable enough for ARMY aviation. The wires, the tips, and the harness assemblies have all had major failures within the first 3 months. Some tips broke on initial issue to the user, causing what I think should be a QDR issue.
		2	0	
		3	0	The warnings are extremely loud but that is not a CEP problem.
		4	0	
		5	0	
		6	0	
		7	0	
		8	0	Wire laying on outer ear causes hot spots, wire is too long and gets caught in shirt, seat belts, vest, etc.
9	0	The only problems I had were noted on the cover sheet (1 and 3). Wire breakage at transducer and screw tip breaking off.		
10	1	Can't hear as well. They pull out when donning, extremely uncomfortable, can't hear as well, does not reduce noise as well.		
7.	1	0		
	2	1	Only that the CEPs would sometime operated intermittently, but nothing significantly	
	3	0	The only problem I have is the wore getting caught and pulling on the earplugs when I turn my head	
	4			
	5	0		
	6	0		
	7	1	Aircraft audio tones extremely loud.	
	8	0	The problems I have encountered you have already addressed.	

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP	
7.	9	0	Problem getting the right size foams.	
	10	0		
	11	0	Wire pulls CEP out of ear.	
	12	0	All problems were addressed in the questionnaire.	
	13	0	I had a wire break at the CEP when removing my helmet. I really like them.	
	14	1	The wire harness is difficult to lay around the ear properly. It will cause some minor discomfort if harness is not properly routed around the ear. The wires tend to snag on harnesses and connector within the cockpit.	
	15	0		
	16	0	Forgetting to unhook before doffing.	
	17	0	Don't use. Don't like it.	
	18	0	Better quality	
	19	0		
	20	0	Slight discomfort after 3-4 hour flights. Ears get a bruised feeling occasionally.	
	21	0	Only problem is the slight "hot spot" mentioned in Q26.	
	22	0		
	23	0		
	8.	1	0	Availability of parts-we do not have enough helmets or CEPs. Sometimes the wires can get over my ear and between earcups and cause discomfort.
		2	0	
		3	0	None that have not been discussed earlier.
		4	0	
		5	0	The foam inserts in the helmet push on the CEP ear plugs which cause ear pain.
		6		
		7		
		8	0	No major problems.

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
8.	9	0	My left ear canal is now tender from everyday use, resulting in just placing the CEP device near my left ear for now.
	10	1 Caution warning and advisory signals are always full volume. I do not wear CEPs during contact training for this reason.	If the ear piece were smaller, it would be more comfortable. If the foam plugs were more firmer, they would be easier to insert.
	11	0	
	12	1 Caution and warning tones cannot be turned down and are too loud for use with CEP.	Foam inserts do not last very long. Wires are prone to breakage at the
	13	0	I cannot use the foam earplug without significant modifications. I always had to use the rubber triple flange earplugs, due to problems fitting the foam ones. The foam ones wear out too fast and pose a problem in replacement.
	14	0	
	15	1 Overall clarity/noise reduction was not improved only amplified. The CEP does not correct deficiencies in the OH-58D ICS system.	I do not like wearing earplugs so my opinion is biased.
	16	1 It takes some time to get used to. Its not as easy as just putting on a helmet. However after it is used for a while you get used to donning and doffing procedure and the sequence you must go through to get it on.	Mild pain in the ear canals after 2 hour flights. Donning procedure requires a sequence that must be followed or CEP will be pulled out. Basically the CEP must be donned just prior to helmet use.
	17		
9.	1	0	Have not worn CEP long enough.
	2	0	
	3	0	Wax in the plug canal, broken wire right plug, uncomfortable after a period of time.
	4	0	
	5	0	
	6	0	
	7	0	With doors off aircraft has significant noise.
	8	0	
	9	0	CWA too loud!
	10	0	
	11	0	

Q1 Unit location	Q1 ID Num	Q42 Adverse effects of CEP	Q43 Problems encountered while wearing CEP
9.	12	0	Donning the helmet with CEP can't be done with flight gloves on.
	13	0	
	14	0	
	15	0	
	16	0	
10.	1	0	With all noise/radio/ICS levels in a comfortable range a CWA message/tone in an OH-58D is extremely loud and annoying.
<b>Overall Total</b>	<b>N = 152</b>	<b>Yes = 27</b> <b>No = 118</b> <b>NR = 7</b>	

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
1.	1	The need to be more accessible and should be fielded to all helicopter pilots	7
	2	Great! Use to wear earplugs occasionally resulting in hearing difficulty in the cockpit. I wear CEPs all the time now. I hear perfectly and I am also protected from outside noises.	7
	3	Good noise attenuation during gunnery but needs to be a little more durable.	5
	4	No big problems yet. Haven't flown with them much yet.	5
	5	The benefits greatly outweigh the time and difficulty putting them on.	7
	6	Very nice increase in hearing ability of ICS, radios. The caution/warning tones are excessively loud now.	7
	7	Overall CEPs are a valuable asset. They only have a few minor problems but overall they improve our ability to accomplish our mission.	7
	8	I would rather the original problem be fixed instead of giving me another piece of equipment. Fix the ICS problem and throw out your temporary fix. While you are at it give me a helmet with active noise cancellation. The computer in the aircraft will tell me of any problems prior to me hearing any change in engine noise anyway.	7
	9	They are great - you just really need to take care of them.	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
1.	10	Slightly better hearing protection, slightly better quality audio. Benefits aren't really worth the hassle of use. Plugs leave ear canals feeling they have been bored out with a cleaning brush.	3
	11		7
	12	Need to be more rugged	7
	13		6
	14	Bulk of the transducer	7
	15	They significantly increase the clarity of radio traffic	7
	16	EXCELLENT! Need to field all units, back fill others. This has improved crew safety and communications immeasurably	7
	17	ICS is definitely better, however the fragility of the systems lends itself to breaking	3
	18		7
	19	Definitely needed device. Just come up with a better design.	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
1.	20	This is one of the Army's best ideas. The radios in the OH-58D(I) are hard to hear without the CEPs. The CEPs help dramatically in the ability to hear and comprehend the radio traffic. You don't have to focus all your attention on the radios with the CEPs in. This is a great product.	7
	21	We absolutely need them! They could be a little louder	7
	22	The entire Army should have them	7
	23		6
2.	1	The CEP is long overdue. Excellent!! My first CEP broke but I was able to acquire another by someone leaving and I have taken better care of it.	7
	2	Excellent	7
	3	I think there is a world of difference with the CEP. Noise is reduced and clarity over the radio is so much better.	6
	4	Getting to the point of too many wires on the head: helmet, ODA, goggles and neck strap, CEP and lip light.	7
	5	Other than the wire getting caught on the vest and other equipment, I thought the CEPs were a great improvement over just the helmet. I couldn't wear yellow ear plugs because I could not hear at all. This is a great improvement.	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
2.	6	Much easier hearing crew members as well as the radios.	7
	7	Great product. Continue to improve and field to everyone.	7
	8	I used to wear yellow foam earplugs all the time. Once I started using CEPs I got addicted to being able to understand the radios. But they are so painful after prolonged periods that now I don't use any additional hearing protection. But I still don't use them except for gunnery.	5
	9	Commo is much more easily understood while using CEPs, however if you use CEPs for 50 more hours and then revert back to yellow earplugs, you can have almost nothing!	7
	10	Significantly improved cockpit communication	7
	11	Great device but need more replacement foam inserts!	7
	12	I like them a lot. The difference between not wearing them and wearing them is night and day.	7
	13	Foamy does a good job with noise levels. It is a pain in the ass by getting caught where vest and collar meet. It would pull the CEP slightly from the ear. Plus the CEP is cheaply built. The cost is extremely high.	6
	14		6

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
2.	15	After using CEPs exclusively and then having them break, I had to go back to yellow ear plugs with great reduction in hearing performance. I had gotten very used to being able to hear communications clearer.	6
	16	CEPs are great! I was really upset when mine broke. Can't wait to get another pair.	7
	17		6
	18	Good item if wires and foam tips are improved. Use same material as yellow foam earplugs?!	7
	19	Though not comfortable, I could definitely hear all radios and ICS better	
	20	I hope I never have to go back to flying w/out CEPs or something like them. The benefits far exceed the discomfort I have to put up with. If they were made more comfortable they would be better yet.	7
3.	1		7
	2	I like it. Need more durable product	7
	3	Sometimes it gets hung up when turning head which could distract pilots at critical times during flight. It enhances mission performance when you can actually hear what is being transmitted over the ICS and radios	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
3.	4	A/C needs voice activated ICS due to work load and the need for cockpit communications.	7
	5	The CEP works great but it is a bit too fragile the wires are too weak and the location needs to be moved	7
	6	It has been a pleasure , especially when flying from the right seat. It has added a significantly wider volume range. I can turn a radio volume knob all the way down and still adequately hear and understand speech on that radio. I never advocate crewmembers pulling their ICS pins, and do not have to when utilizing the CEP. It makes flying with doors off much more pleasurable.	7
	7	Viable product. I endorse it	7
	8	These earplugs seem to me a bandaid over the larger problem. Rather than investing any more money, time or equipment on these earplugs how about putting some better ICS boxes in the aircraft. The aircraft at FT Rucker had VOX boxes in the aircraft. Those boxes were more than adequate. I used both my SPH-4B and HGU-56 with earplugs with the VOX box and had plenty of volume in all flight modes.	2
	9	After getting used to them I have found them to be an outstanding product	6
	10		7
	11	Love them!	7
	12	Works well can hear radios well reduces aircraft noise	6

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
3.	13	Great. Help hearing co-pilot over noise of aircraft/radios. I would consider this essential to good cockpit crew co-ordination and communication. This is common to everyone I know who uses these plug phones. Also, Also, I never pulled the CEP's from ears by the wires. Please provide durable plugs ASAP.	7
	14	Excellent product!! I do not think I could fly without it now.	7
	15		5
	16	Due to the task load of the CPO in the OH-58D, the CPO must use "hot mic" on the ICS. This degrades the level of audio clarity. This aircraft must have "voice activated" (VOX) ICS, as a minimum at the CPO station. This will greatly improve the communication clarity of the aircraft. I have used these at Ft rucker and was well pleased with them.	2
	17		
4.	1	The communications clarity is excellent - the improvement is worthwhile. We need just minor fixes.	6
	2	I love them. Try to improve.	7
	3	Even with the added time and some discomfort, the CEPs are far superior to the older helmets.	7
	4	Don't like it.	1

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
4.	5	Overall it is a good system but it needs to have a more durable wire and connection. Must be a stronger wire.	6
	6	It looks goofy with the large ear cuffs.	5
	7	I like the CEP much better then the old SPH-4 but the shape leaves a little to be desired. The SPH-4 was a better looking helmet.	7
	8		6
	9		7
5.	1	CEPs work well in clarifying speech and being able to communicate in the cockpit.	7
	2		5
	3	Extend the length of the helmet chin strap to ease helmet donning with earplugs installed and shorten slightly the length of the tube inside the foam on the plug itself to ease ear canal pain. The CEP has greatly increased the safety of flight in the OH-58D. Do not take it away. I can hear the radios and my co-pilot at all time now.	7
	4		7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
5.	5	They are awesome! The ability to hear everything is so much better with these CEPs I can live with a little discomfort. The safety benefit of being able to hear the other pilot is also a giant plus. Doors off flying is so much better now.	7
	6	Just purchase the BOSE headsets and put them into our helmets, it's a superior proven product. Good idea but poor design! Too cumbersome when doing exercises. Cannot put helmet on and go. You are required to "fiddle with it".	5
	7	Makes a big difference in hearing radios and internal communications.	7
	8	The ARMY has finally purchased a piece of equipment that not only is functional, but doesn't burden the soldier with its use. Thanks!	7
	9		7
	10	The CEP has improved the ICS systems clarity and radio clarity 100%. Especially with doors off. I think the CEP is a good improvement for OH-58D pilots.	7
	11	An excellent system that improves ICS communication and reduction in noise. I would not want to fly without the CEP after flying with it.	7
	12		7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
5.	13	All ICS and radio communications is significantly better. Crew coordination is better - radio management is much easier since the pilot doesn't have to have all radios turned all the way up in order to hear anything. The number of "say again" and "what did you say" have significantly decreased.	7
	14		6
	15		7
	16	Correct piece of equipment.	7
6.	1	Reorder problem- PCS of pilots caused severe shortage of CEPs available to new arrivals. CIF was making ALSE turn in the helmets as a complete kit with CEP installed. Can't get thru normal supply but as GSA item causing problem due to lack of funds. Once I punch a hole thru the back of the earcup black plastic liner, that condemns the helmet for turn-in procedures - again causing a reorder problem for the ALSE maintainers. I would like to see an improved earphone assembly, such as the BOSE system in the HGU-56/P instead of an additional item to be maintained, taught, installed, and stocked. 60% of the original pilots have gone and new pilots do not have CEPs	6
	2	I like it. It works well.	7
	3	I would like a more durable and sturdy product. I am always afraid of breaking them.	6
	4		6

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
6.	5	Great system. Just make wiring system more durable (most pilots wash their earplugs with flight suit).	7
	6	Very, very fragile.	6
	7	They are great but break easily.	7
	8	Greatly improves volume levels in the OH-58D, sometimes the FM radios are impossible to hear without CEP.	6
	9	Great idea but poor design in durability.	7
	10	Very little. I don't like it.	1
7.	1		7
	2	I think it's a great product or piece of equipment that is very much needed for the OH-58D(I)	7
	3	Although there are some minor problems with the CEP, it has significantly enhanced my ability to communicate within the cockpit and over the radios. I have absolutely no desire to give up my CEP and go back to my old helmet system	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
7.	4	It would have been nice to have an ICS setup so one would not need a CEP. I still have a difficult time understanding what is said because of the static.	5
	5		7
	6	I do not want to fly without my CEP. Since wearing the CEP I can now hear everything in the cockpit. My overall rating for the CEP is excellent.	7
	7		6
	8	Very good device.	7
	9	I like them	7
	10		7
	11	Outstanding, even with the minor problems.	7
	12	Great addition to aviation flight aids even with the minor problems. We need this device.	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
7.	13	I refuse to fly without them. It makes the job much easier. It's really obvious when flying with a pilot w/o the CEPs. I'll understand a radio message while the other pilot is saying "say again".	7
	14	It is a great idea! I use the CEP always. If the speaker was smaller and the wire stronger it would be a better product. Also the foam plug portion would be better if it held its form when compressed like yellow foam plugs do.	7
	15	Great system, however the wire keeps breaking from the ear plug.	7
	16	Drastic improvement over using foam ear plugs. Clear communications. You don't have to turn radios up full blast. The word is a hassle and time consuming but I still wouldn't be caught without my earplugs. Suggestion: make two connectors, one in each earcup. This will eliminate the cord catching on seatbelt and goggles.	7
	17		4
	18		5
	19	Great idea - Needs a better design. We already have up to 3 wires hanging off our helmets. Adding another wire with the CEP does not help things.	6
	20	I like them! Make the plastic tube a bit shorter and more flexible.	7
	21	Really improves the ability to keep out outside noise from the aircraft.	7

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
7.	22	They make hearing great. So much better than flying with earplugs but they are a hassle to put on. I only used them on real mission and just tolerated the lack of being able to hear the rest of the time. Bell needs to fix the aircraft so we can hear. CEPs need to be more comfortable like the ones the NASCAR drivers use.	5
	23	These have completely revolutionized aviation. It is terrific. The ability to hear everything is a critical part of aero-scouting and this has enhanced it greatly. I love them and I pity anyone without them.	7
8.	1	Alignment of goggles, they don't always align with my eyes, if we could get dual adjusting goggles - this would solve that	7
	2	I like the system, but the problem I have found is if I use plain foam earplugs, I cannot hear the ICS as well. If I wear the CEP everything sounds fine. Another concern of mine is that I hear a lot more acft noise wearing the HGU-56 and CEP system.	5
	3	Improves the internal and external communications. Allows me to monitor not only the radios but also copilot/student communication.	6
	4	Good idea, ergonomically not the best product.	6
	5	Great system.	6
	6	Do not use.	

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
8.	7		1
	8	I like them. They improve hearing significantly!	7
	9	Great device. You may not have it back.	5
	10	Worthwhile.	6
	11	Concerned about lack of maintenance or replacement. I will be seriously disappointed when my CEPs are no longer serviceable and there will be no replacement.	
	12	Good compromise/ low cost alternative to actually fixing the OH-58D ICS system.	7
	13	I would like to see rubber styles. They would last longer and fit easier. I love the increased audio clarity of the CEP, and I feel it is a must in the OH058D. However, it breaks too easy and the foam sizes are too restrictive and wear out too fast.	6
	14	Great addition especially in the OH-58D (I) Kiowa Warrior.	7
	15	I have had experience flying/testing with an Active Noise Reduction system. I prefer that system because it removed or reduced unwanted noise.	3

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
8.	16	Aviation is a noisy environment so most people wear earplugs on the flightline during pre-flight, etc. and this requires removing one set of plugs and replacing them with others. I like being able to hear, but the donning/doffing procedure stinks. It pulls out a lot which I can't stand. After a while you rig it so this doesn't occur. A lot of people do not use it for this reason. But in the end when all on correctly - hearing is great!!	5
	17	It does reduce noise level but it is more of a pain to maintain and use in a time critical environment.	3
9.	1		6
	2	This is the absolute best thing that R&D has added to the aircraft-Pilot interface I have seen. I can hear everything I need to without sacrificing my inner ear. The safety margin has been greatly increased now that ICS is clear and concise. Radio traffic is easily monitored. It is worth the slight amount of discomfort. I would personally buy my own set if not issued.	7
	3	Overall much better.	7
	4	Best thing to come along for 58D's, increases ability to hear everything.	7
	5	The speaker assembly should be smaller so it doesn't rub on the ear cup foam. The size of it causes extra pressure on ear canals. Suggest a molded type ear plug such as those used with race car helmets.	7
	6	I like the system despite the added steps. I can now actually turn down the volume on the ICS control.	6

---

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
9.	7		6
	8	Improvement.	7
	9		6
	10		5
	11		5
	12	Why didn't somebody think of this before?	7
	13	Infinitely better.	7
	14		6
	15	Generally do not like HGU-56. Poorly engineered. Should not have to have modification.	
	16		7

---

Q1 Unit location	Q1 ID Num	Q44 General comments about CEP	Q45 Rate overall value of CEP
10.	1	Love them! Keep improving them and get them in the supply system immediately. One just must figure out which order to put on the equipment, goggles, CEP, helmet	7
<b>Overall total</b>	<b>N = 152</b>		<b>Mean = 6.3</b> <b>SD = 1.3</b> <b>NR = 5</b>

## Reference

Murphy, B.A., and Mozo, B.T. 1999. Flight Evaluation of the Communications Earplug (CEP) in the OH-58D Helicopter. (Part 1) Fort Rucker, AL: U.S. Army Aeromedical Research Laboratory. USAARL Report No. 2000-04

Appendix.

**EVALUATION OF THE COMMUNICATIONS EARPLUG IN THE  
OH-58D HELICOPTER ENVIRONMENT**

**INSTRUCTIONS:** You have been asked to wear the Communications Earplug (CEP) in conjunction with your aviator helmet during your daily mission to evaluate its operational effectiveness and comfort. Please complete the following questionnaire. Most questions are self-explanatory with room for comment. Please try to be as precise as possible when making your comments. Some questions will require you to mark on a continuum between extremes. Your responses should be indicative of the strength of your feelings. **Note:** Please bear in mind that all comparison questions are between the helmet you normally used in the past and the CEP.

**Personal data:**

1. Unit location: \_\_\_\_\_
2. Today's date: \_\_\_\_\_
3. Sex: \_\_\_M \_\_\_F
4. Experience as an aviator: \_\_\_\_\_ years. Approx. No. flight hours: \_\_\_\_\_
5. No. flight hours wearing HGU-56/P helmet (prior to CEP installation): \_\_\_\_\_
6. No. flight hours wearing CEP: \_\_\_\_\_  
Is the CEP still functioning properly? \_\_\_Yes \_\_\_No  
If no, describe the malfunction \_\_\_\_\_
7. CEP foam tip size: \_\_\_ Standard \_\_\_Slim \_\_\_Short \_\_\_Combination
8. Seat position during most flights: \_\_\_\_\_
9. Do you have a waiver or information only letter (IO) for a hearing loss?  
\_\_\_Yes \_\_\_No \_\_\_Not Sure If Yes, how long have you been on waiver? \_\_\_\_\_
10. Do you normally wear eyeglasses when flying? \_\_\_Yes \_\_\_No  
If Yes, what type temples are on the glasses you normally wear?(examples: bayonet temples, wire frames etc)  
\_\_\_\_\_

**Personal Hearing Protection:**

11. Prior to CEP installation, did you wear earplugs in conjunction with your flight helmet?  
\_\_\_Yes \_\_\_No If No, skip next question.
12. Did you frequently experience discomfort with your earplugs? \_\_\_Yes \_\_\_No  
If Yes, how long does it take before you feel the discomfort \_\_\_\_\_  
Describe the discomfort (example: itchiness, pain etc) \_\_\_\_\_
13. Prior to CEP installation, did you frequently experience discomfort with your helmet while flying?  
\_\_\_Yes \_\_\_No  
If Yes, how long does it take before you feel the discomfort? \_\_\_\_\_  
Describe the discomfort (examples: hot spots, headache etc) \_\_\_\_\_



28. If you experienced discomfort with CEP during your flight, when did you first notice the discomfort?  
Please circle the appropriate time below.

1/2 hr   1 hr   1-1/2 hrs   2 hrs   2-1/2 hrs   3 hrs   3-1/2 hrs   4 hrs

29. With respect to overall fit and comfort, compare the CEP device with your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
-------------------------	----------------------	--------------------	------	-------------------	---------------------	------------------------

**Donning and Doffing:**

30. Does the addition of the CEP result in differences in the helmet donning procedure?

Yes  No    If Yes, please explain \_\_\_\_\_  
\_\_\_\_\_

31. Does this extra step pose a significant problem in completing your mission?  Yes  No

If Yes, please explain \_\_\_\_\_  
\_\_\_\_\_

32. Do you have problems donning/doffing the CEP with gloves on?  Yes  No

If Yes, please explain \_\_\_\_\_  
\_\_\_\_\_

33. If you forgot to disconnect the CEP when doffing, was there any discomfort or difficulties when the CEP was removed?  Yes  No

If Yes, please explain \_\_\_\_\_  
\_\_\_\_\_

34. With respect to donning/doffing, compare the test device to your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
-------------------------	----------------------	--------------------	------	-------------------	---------------------	------------------------

35. Rate the difference in ICS speech clarity/understanding when compared to your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
-------------------------	----------------------	--------------------	------	-------------------	---------------------	------------------------

36. Rate the difference in speech clarity/understanding of personnel based on gender of the talker when compared to your personal helmet.

**Male Voice**

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
-------------------------	----------------------	--------------------	------	-------------------	---------------------	------------------------

**Female Voice**

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
-------------------------	----------------------	--------------------	------	-------------------	---------------------	------------------------

37. Rate the difference in overall speech clarity/understanding when compared to your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
----------------------	-------------------	-----------------	------	----------------	------------------	---------------------

**Noise Reduction/Attenuation:**

38. With respect to reducing noise levels at your ears, compare the CEP to your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
----------------------	-------------------	-----------------	------	----------------	------------------	---------------------

39. With respect to allowing you to hear navigational and caution/warning signals, compare the CEP to your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
----------------------	-------------------	-----------------	------	----------------	------------------	---------------------

40. With respect to your ability to hear and monitor noise generated by the aircraft, compare the CEP to your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
----------------------	-------------------	-----------------	------	----------------	------------------	---------------------

41. With respect to reducing noise levels at your ears during weapons firing, compare the CEP to your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
----------------------	-------------------	-----------------	------	----------------	------------------	---------------------

**General Issues:**

42. Were there any adverse effects of CEP performance?  Yes  No  
If Yes, please \_\_\_\_\_

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

43. Please elaborate on any problems you may have encountered while wearing the CEP.

\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_  
\_\_\_\_\_

44. General comments about your experience with the CEP.

---

---

---

---

---

---

---

---

45. Based on your flying experience, rate the overall value of the CEP when compared to your personal helmet.

Significantly Better	Moderately Better	Slightly Better	Same	Slightly Worse	Moderately Worse	Significantly Worse
-------------------------	----------------------	--------------------	------	-------------------	---------------------	------------------------